



This is a digital copy of a book that was preserved for generations on library shelves before it was carefully scanned by Google as part of a project to make the world's books discoverable online.

It has survived long enough for the copyright to expire and the book to enter the public domain. A public domain book is one that was never subject to copyright or whose legal copyright term has expired. Whether a book is in the public domain may vary country to country. Public domain books are our gateways to the past, representing a wealth of history, culture and knowledge that's often difficult to discover.

Marks, notations and other marginalia present in the original volume will appear in this file - a reminder of this book's long journey from the publisher to a library and finally to you.

### Usage guidelines

Google is proud to partner with libraries to digitize public domain materials and make them widely accessible. Public domain books belong to the public and we are merely their custodians. Nevertheless, this work is expensive, so in order to keep providing this resource, we have taken steps to prevent abuse by commercial parties, including placing technical restrictions on automated querying.

We also ask that you:

- + *Make non-commercial use of the files* We designed Google Book Search for use by individuals, and we request that you use these files for personal, non-commercial purposes.
- + *Refrain from automated querying* Do not send automated queries of any sort to Google's system: If you are conducting research on machine translation, optical character recognition or other areas where access to a large amount of text is helpful, please contact us. We encourage the use of public domain materials for these purposes and may be able to help.
- + *Maintain attribution* The Google "watermark" you see on each file is essential for informing people about this project and helping them find additional materials through Google Book Search. Please do not remove it.
- + *Keep it legal* Whatever your use, remember that you are responsible for ensuring that what you are doing is legal. Do not assume that just because we believe a book is in the public domain for users in the United States, that the work is also in the public domain for users in other countries. Whether a book is still in copyright varies from country to country, and we can't offer guidance on whether any specific use of any specific book is allowed. Please do not assume that a book's appearance in Google Book Search means it can be used in any manner anywhere in the world. Copyright infringement liability can be quite severe.

### About Google Book Search

Google's mission is to organize the world's information and to make it universally accessible and useful. Google Book Search helps readers discover the world's books while helping authors and publishers reach new audiences. You can search through the full text of this book on the web at <http://books.google.com/>

Palmateer, Theodor G.  
Elementary machine shop practice.

Stanford University Libraries



3 6105 04931 3658

# ELEMENTARY MACHINE SHOP PRACTICE

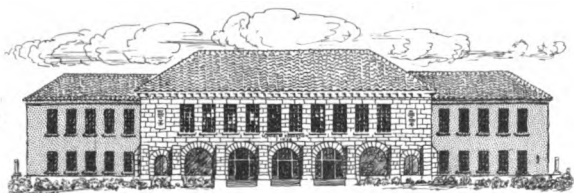


Tx.

680.6

P171

PALMATEER



SCHOOL OF EDUCATION  
LIBRARY

TEXTBOOK COLLECTION

GIFT OF

T.J. Palmateer



STANFORD UNIVERSITY  
LIBRARIES

and

Compliments

J. J. Palmateer



# ELEMENTARY MACHINE SHOP PRACTICE

BY

**T. J. PALMATEER**

INSTRUCTOR IN MACHINE SHOP PRACTICE  
LELAND STANFORD JUNIOR UNIVERSITY  
PALO ALTO, CALIFORNIA



**THE MANUAL ARTS PRESS**

PEORIA, ILLINOIS

*Q. 2*

**610030**

**Q**

Copyright, 1918  
Copyright, 1920  
**T. J. PALMATEER**

## PREFACE

The first edition of *Elementary Machine Shop Practice* was intended as an instruction book for shop use only. The revised edition contains several additional pages of new matter which gives it a wider range of usefulness.

To get the best results from the book the problems described should be made, because the information may then be directly applied while the student is at work in the shop. But in schools where problems of different design are used, or if machine parts are made, it is believed the book will be a great help as a reference. It may also be used to good advantage in classes of technical English.

In case it is considered advisable to devote to the elementary operations less time than would be necessary to complete the problems presented herein, very good results can be obtained if the student will read all of the instructions carefully and then do only such problems as the instructor considers necessary.

The instructions here given are not intended as fixed rules, for it is recognized that some of the operations may be done by other methods with equally good results.

Many thanks are due to Prof. E. P. Lesley and H. P. Miller, Jr., for their helpful assistance in the preparation of this book; and to the following manufacturers for the electrotpe illustrations: Smith & Mills Co., Sibley Machine Co., Lodge & Shipley Machine Tool Co., The Cincinnati Milling Machine Co., and the Brown & Sharpe Co.



# CONTENTS

	PAGE
<i>Introduction</i> .....	7
<b>CHAPTER I—VISE WORK</b>	
<b>Problem 1</b> —Surfacing a Cast-Iron Block.....	9
Chipping—Sharpening Chisels—Files and Filing—	
Scraping—Use of Surface Plate—Grinding—Scraper	
—Oilstoning Scraper.	
<b>CHAPTER II—SHAPER WORK</b>	
Description of Shaper.....	18
<b>Problem 2</b> —Planing One Surface Square with Another.....	19
Clamping Work in Vise—Roughing Cut—Setting Fin-	
ishing Tool—Rate of Feed—Resetting Work—To Pre-	
vent Corners from Breaking.	
<b>Problem 3</b> —Planing One Surface Parallel with Another and Planing	
Angles .....	26
Roughing Out Angles—Setting the Head, Clapper Box,	
and Tool—Finishing Angles.	
Questions .....	31
<b>CHAPTER III—DRILLING</b>	
Description of Drill Press.....	32
<b>Problem 4</b> —Drilling and Tapping.....	34
Laying Out Centers of Holes—Holding the Work—	
Selecting Drill—How Drills are Ground.	
<b>CHAPTER IV—TAPS AND DIES</b>	
Taps and Dies.....	40
Use of Taps—Hand Tapping—Machine Tapping—Use	
of Dies.	
<b>CHAPTER V—LATHE WORK</b>	
Description of Lathe.....	46
Parts of Lathe.....	48
<b>Problem 5</b> —Fitting Shaft to Collar.....	49
Centering—Placing Work in Lathe—Finishing End of	
Shaft—Turning Shaft—Speed of Lathe—Adjusting	
Lathe to Turn Straight—Filing.	
<b>Problem 6</b> —Turning and Threading Taper Shaft.....	56
Use of Lubricant—Cutting Recess—Size and Shape of	
Threads—Grinding Tool—Setting Tool—How Lathe Is	
Geared—Why Feed should be Disconnected—Finishing	
Side of Thread—How to Reset the Tool.	

# CONTENTS

	PAGE
<b>Problem 7—Boring and Turning Cast-Iron.....</b>	<b>65</b>
Use of Lathe Chucks—Centering Work in Chuck—Rough Turning—Use of Flat Drill—Use of Boring Bar—Why Reamers are Used—Boring and Reaming Hole—Inside Threading—Finishing Taper—Drilling and Reaming—Advantage of Rose Reamer—Use of Mandrel, or Arbor—Making Mandrel—Threading—Finishing Outside Cast-Iron—Micrometer Caliper—How to Read the Micrometer—Knurling—Turning Tool for Brass—Drilling Brass.	
<b>Problem 8—Brass Plumb Bob with Steel Point.....</b>	<b>85</b>
<b>CHAPTER VI</b>	
Survey of Lathe and Shaper Tools.....	88
Shape of Tools—Steel for Cutting Tools—How to Determine the Difference between High-Speed Steel and Carbon Steel—How to Determine the Hardness of Tools—Rate of Feed—Depth of Cut.	
Questions .....	91
<b>CHAPTER VII—MILLING MACHINE WORK</b>	
Description of Milling Machines.....	92
<b>Problem 9—Milling a Square Casting.....</b>	<b>94</b>
Milling Machine Vise—Clamping the Work—The Cutter—The Arbor—Direction of Cutter Rotation—Cutter Speed—Direction of Feed—Roughing Cut—Finishing Cut.	
<b>Problem 10—Milling a Concave Surface, Recess, etc.....</b>	<b>99</b>
Use of End Mill—Depth of Cut—Speed of Cutter—Milling Slot—Gang Milling—Groove Cutting—Forming Cutter.	
<b>Dividing Head and Tail-Stock.....</b>	<b>103</b>
Index Plate—Index Crank—Index Pin—Indexing—Examples of Use for Dividing Head.	
<b>Spur Gears and Rack.....</b>	<b>106</b>
Terms Used—Shape of Tooth Cutter—Rules for Computing Spur Gears.	
<b>Problem 11—Gear Cutting.....</b>	<b>110</b>
Selecting Cutter—Mounting Cutter—Centering Cutter—Mounting Gear in Machine—Depth of Cut—Setting Index Crank—Setting the Sector.	
Cutting a Rack.....	112
Questions .....	115
Index .....	118

## INTRODUCTION

This manual, while it does not cover the whole field of machine shop work, should meet the requirements of beginners in general machine shop practice. Its main object is to reduce as much as possible the time required to bring a student with no previous shop experience to the point where he is able to do some real work. For this purpose the problems have been designed with the view of giving the student the maximum amount of information in the small amount of time usually allowed for this purpose. The repetition of operations has therefore been avoided wherever it was considered advisable and the time lost in simply cutting off metal has been reduced to the minimum.

The instructions given refer mainly to the cutting of metal, since this usually gives the most trouble to beginners. Little attempt has been made to describe the mechanism of the different machines because it varies so much with the type and make, and besides is easily understood by the average student.

It is assumed that beginners will receive oral instruction on the manipulation, such as shifting the belt, handling the feed control, etc., of the different machines. It is suggested that the instructor give a practical demonstration by doing enough work on the problems to show the tools necessary and how they are used.

The machine speeds for the different operations as indicated in this book are only approximately correct, since the actual cutting speed of the tool in feet-per-minute varies with the size and kind of machine used. The instructor is expected to designate the proper speeds, altho the belt connections given herein will generally be close enough for beginners.

In learning machine shop work the student goes thru what might be called two stages, i.e., elementary and advanced. In the elementary or beginning stage it will be necessary for him to acquire considerable knowledge or theory. After the fundamentals have been mastered, practice appears to be the more important factor.

Since the progress that a beginner makes depends largely upon the time required to learn the fundamentals, it is important that he study very carefully the directions for making the problems.

# ELEMENTARY MACHINE SHOP PRACTICE

## CHAPTER I VISE WORK

Altho most of the metal cutting in the machine shop can be done by machine, it is sometimes necessary, even in the most modern shops, to do some of it by hand. In order to give the student practice in this hand, or vise work, the sides A and B of the cast-iron block, Fig. 1, are to be finished by chipping, filing and scraping.

### Problem 1.—Surfacing a Cast-Iron Block.

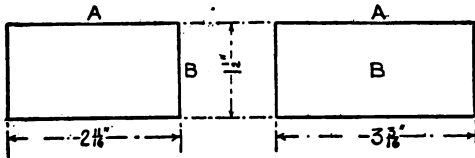


FIG. 1

### Sequence of Operations:

1. Chip and file side A.
2. Scrape side A true to a surface plate.
3. Chip and file side B square with A.
4. Scrape side B true to surface plate.

**Chipping.**—The original surface of cast iron is very hard for a depth of about  $1/64$ " and is almost impossible to file. It is therefore necessary to remove this hard scale with chisels before starting to file.

For this sort of chipping, cape and flat chisels, Figs. 2 and 3, respectively, are used.

Parallel grooves are first cut in the surface as shown in Fig. 4. These grooves must be just deep enough to get under the scale, i. e., not less than  $1/32''$  nor more than  $1/16''$  deep.

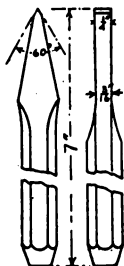


FIG. 2



FIG. 3

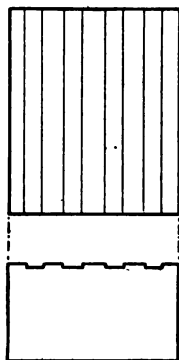


FIG. 4

When they have been cut to within  $1/4''$  of the end, the direction of chipping should be reversed to prevent breaking out the cast iron at the corner.

The grooves should be uniformly spaced, in this case, about  $1/4''$  to  $5/16''$  apart. On heavier work, where larger chisels are necessary, the grooves are cut further apart. Generally the distance between the grooves should be about equal to the width of the cape chisel used.

Care should be taken not to chip one portion of the surface deeper than another; the more uniform the grooves the less will be the filing required to make the surface straight. The metal ridges are chipped off with the flat chisel shown in Fig. 3.

**Sharpening the Chisels.**—To do good work the chisels must be kept sharp by grinding on a fine grinding wheel. Care should be taken not to hold them too hard against the wheel, thus drawing the temper.

If the chisels are to be used for very light cuts, say  $1/64''$  deep, the cutting edge may be ground to a smaller angle than is shown in Figs. 2 and 3.

### Files and Filing

**Files.**—While there is a large variety of shapes and sizes of files manufactured, only the ones to be used on these problems will be described. Students desiring further information on files should consult the catalog of some standard file manufacturer.

Files are designated by their size, type, and the coarseness or cut of their teeth.

The size refers to the distance from the end of the file to the point where the tang begins, Fig. 5.

The type refers to the general shape of the file. Those most commonly used in a machine shop are the mill, flat, hand, square, round and half-round files.

The mill, flat and hand files are very similar in shape, but differ from one another in detail.

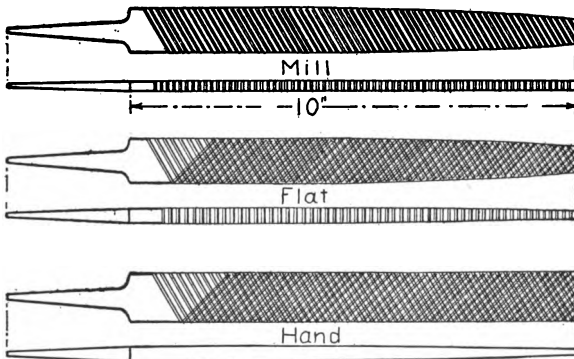


FIG. 5

The *mill file* is uniform in thickness, tapered in width and is single cut, i. e., has only one course of teeth. It is used principally for lathe work.

The *flat file* is tapered in both width and thickness and is double cut. It is intended mainly for general use and is not suitable for lathe work.

The *hand file* is uniform in width, tapered in thickness and double cut. It is a little wider than the mill and flat file and has one safe edge, i. e., one edge without teeth.

The advantage of this safe edge is that the file may be used close up to a square corner without cutting in at the side. This file is preferred by machinists for flat surfaces, altho the flat file may also be used for such work. An edge of a flat file may be made safe by grinding off the teeth.

The *common square file* is tapered and double cut. It is used for filing square and rectangular holes and on square corners. For this kind of work one edge should be safe.

The *common round file* is tapered and double cut. It is used for filing round holes, concave surfaces, etc.

The *half-round file* is tapered and double cut. It is used on large round holes, concave surfaces and acute angles. The latter use is illustrated in Fig. 30, page 30.

The coarseness or cut of a file refers to the spacing of the teeth. The three different spacings, or cuts, in common use are the bastard, second cut and smooth. Practically all of the common files may be obtained in any of these three cuts.

**Filing.**—Having removed the scale on the cast iron block with chisels, the surface should be filed approximately straight with a hand bastard file. If a hand file is not available a flat file may be used.

In the first rough filing, a full stroke of the file is used, but as the surface approaches a true plane this may be changed to a short stroke. A short stroke makes it easier to control the file. Rocking the file should be avoided as it causes the edges and corners of the work to be filed lower than the center.

To test the straightness of the surface being filed the edge of a steel rule is held on it in several positions.

When filing work of this kind it is advisable to file in different directions, i. e., parallel with one edge, crosswise and diagonally.

The teeth of all files are made to cut on the forward stroke.

For this reason the pressure should be relieved on the return or backward stroke.

It will be noticed upon sighting along the edge of a hand file that the thickness does not taper uniformly, both sides being slightly convex. The curves are supposed to be uniform, but the warping that occurs in tempering causes greater convexity at one place than another. By using the file at the point of greatest convexity and by giving it a short stroke the work may be filed straight even tho the file does rock a little. If the file is warped to the extent that one side is slightly concave it will be impossible to file the work straight with that side.

After the surface has been filed straight with the coarse or bastard file it is finished smoother with a hand or flat smooth file. Instead of filing in different directions, as in rough filing, the strokes should be parallel with one edge of the work. This causes all the scratches or lines made by the file to be parallel, giving the surface a better appearance. If it is to be scraped, as in this case, this will also make it much easier.

When filing cast iron the file dust should never be brushed off the work with the hand, as the hand deposits more or less grease, causing the file to slip and dull quickly. Machinists usually blow off the dust. When filing wrought iron or steel, oil or grease does no harm, in fact oil is sometimes used to produce a smooth finish.

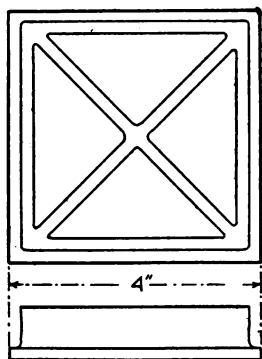
### Scraping

After the surface A has been filed smooth and approximately straight, it is finished to a plane surface with a surface plate and scraper.

**Use of Surface Plate.**—To locate the high places on a flat surface a surface plate, Fig. 6, is used. The size of the plate is usually a little larger than the surface being scraped. The side A is first covered with a thin film of paint made of lamp black and lard oil. It is then placed in contact with the surface to be

scraped and moved around over it, marking the high spots.

The paint should be spread on the plate with the finger tips and just thick enough to cover it. If waste or cloth is used, lint is deposited on the plate and interferes with the marking. If it is spread on too thick, the low places will be marked as well as the high ones.



A  
FIG. 6

It is very easy to locate the high spots if the work is a little concave, but if a little convex the plate is apt to rock when moved over the surface, thus marking the low as well as the high spots. This makes it very important to use as little paint on the surface plate as possible, and to move it

over the work without rocking.

After locating the high spots the scraper is used on them and the work again tested with the plate. These operations are repeated until the surface is true.

**Use of the Scraper.**—In use the scraper is held firmly with both hands at about the angle shown in Fig. 7. The cutting is done by holding it down hard on the work and moving it forward in the direction indicated by the arrow. If the handle is held too high or too low the scraper will not cut satisfactorily. A little practice will be required before a beginner can properly control it.

When using the scraper it will be noticed that it has a tendency to chatter, causing a slightly wavy line cut instead of a smooth one. If all the scraping is done in one direction these chatter marks become deeper. This may be avoided by varying the direction of the scraping a little after each marking with the surface plate.

The scraper is usually made from an old 10" file by grinding off the teeth and forging it to the shape shown in Fig. 8.

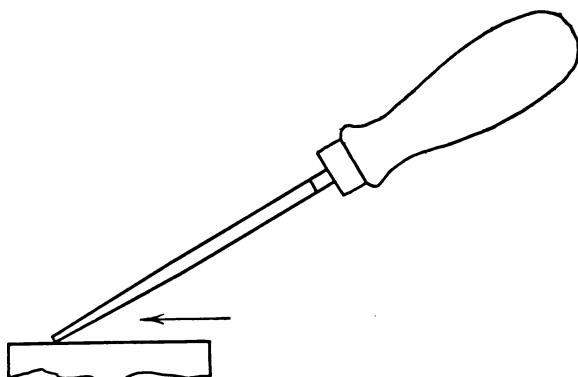


FIG. 7

**Grinding the Scraper.**—After forging and hardening, the scraper is ground straight on the side B, Fig. 8, and slightly convex across the end A. If the latter edge is curved too much, the scraper will take too narrow a cut, while if it is perfectly straight the cut will be so wide that it will not be smooth. The scraper should be ground so as to take a cut about  $1/4''$  or wider.

The edge C should be ground at right angles with the center line of the scraper.

**CAUTION.**—The scraper is made of carbon steel and is tempered very hard. Beginners are therefore cautioned not to draw the temper at the cutting edge by grinding it too fast. This often happens without being noticed so that the beginner is unable to understand why his scraper will not cut.

**Oilstoning the Scraper.**—The grinding wheel produces a somewhat rough cutting edge which must be oilstoned before the scraper will cut smoothly. This oilstoning is done by moving the end and the sides of the scraper alternately over the surface of a flat oilstone.

When oilstoning the end it may be held vertically, Fig. 9, or at a slight angle, as in Fig. 10. If held at an angle the sharpening is done a little quicker and the edge will be slightly

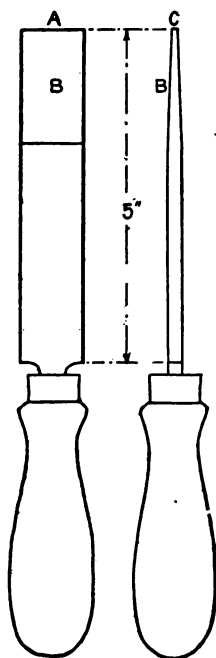


FIG. 8

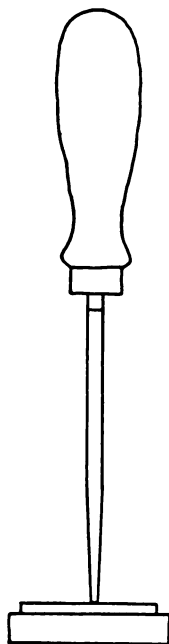


FIG. 9

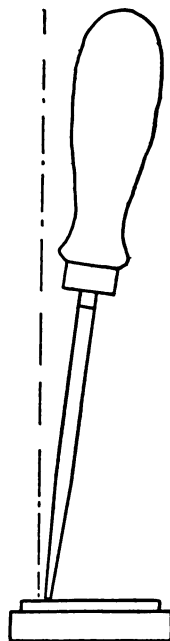


FIG. 10

beveled. Such an edge will cause less chattering than the one obtained by oilstoning as in Fig. 9. When one edge has been sharpened the scraper is turned over and the other edge sharpened in the same manner.

Fig. 11 shows the correct position for oilstoning the side. The handle should not be raised, as in Fig. 12, as this would take off the sharp edge. A fine wire or feather edge is produced, no matter how hard the scraper is tempered. To take advantage of it, the scraper should be oilstoned on the side last

if it is to cut on the forward stroke, as in Fig. 7, and on the end last if it is to cut on the draw stroke.

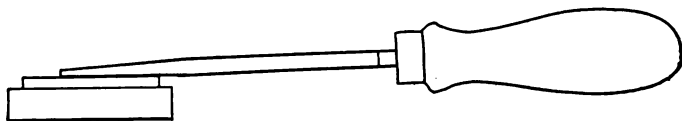


FIG. 11

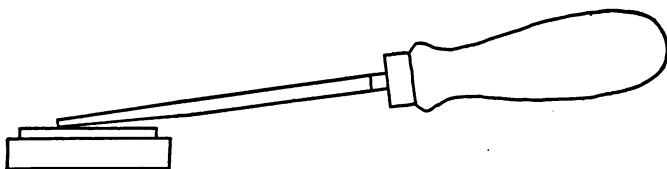


FIG. 12

In order to do good work the scraper must be kept very sharp. It will be necessary to oilstone it several times while scraping the surface of this problem.

When the scraper has been repeatedly oilstoned so that the cutting edges are worn off, the end should be reground on the grinding wheel to the original shape, as shown at C in Fig. 8.

**Finishing Side B.**—After side A of Problem I has been finished, the side B is squared with A by the same process, i. e., by chipping, filing and scraping.

If B is very much out of square with A, one side of B may be chipped a little deeper than the other. In doing this it will be better to take several light cuts with the cape chisel than to try to remove too much metal in one cut. Too deep a cut will cause the edge of the chisel to break.

## CHAPTER II

### SHAPER WORK

**Description of Shaper.**—The size of a shaper is usually designated by its maximum length of stroke; as, a 16" or a 20" shaper.

The shaper shown in Fig. 13 has a four-step cone drive with back gears giving eight speeds. Two sides as well as the top of the table are provided with slots for clamping work that is too large to be held in the vise.

The head is graduated at R so that it may be set at any desired angle, as in Fig. 25, page 28. The clapper box M may be turned to various positions by loosening the hexagonal-head screw N. The heavy casting BBB has a reciprocating motion and is called the ram. The jack D supports the outer end of the table. The lever K controls the back gears.

The table may be raised or lowered by means of a hand crank on shaft E shown at the end of the cross-rail. By placing this crank on the shaft immediately above it the table may be fed horizontally by hand.

The automatic table feed is started, stopped, or reversed by means of a small knobbed pin F which engages the ratchet gear at the end of the cross-rail. The rate of feed is varied, either while the machine is idle or in motion, by changing the position of a large knobbed pin on the disc near the driving cone. The squared shaft above this disc is used for changing the length of the stroke. The position of the stroke is changed by loosening the lever H on top of the ram and turning the squared shaft J shown near the head of the ram.

The vise L is used for holding small work. The jaws are opened and closed by means of a hexagon-headed screw. The square-head screw S is for clamping the movable jaw to the base.

The machine is started and stopped independent of the countershaft, by means of a friction clutch in the driving cone operated by lever O.

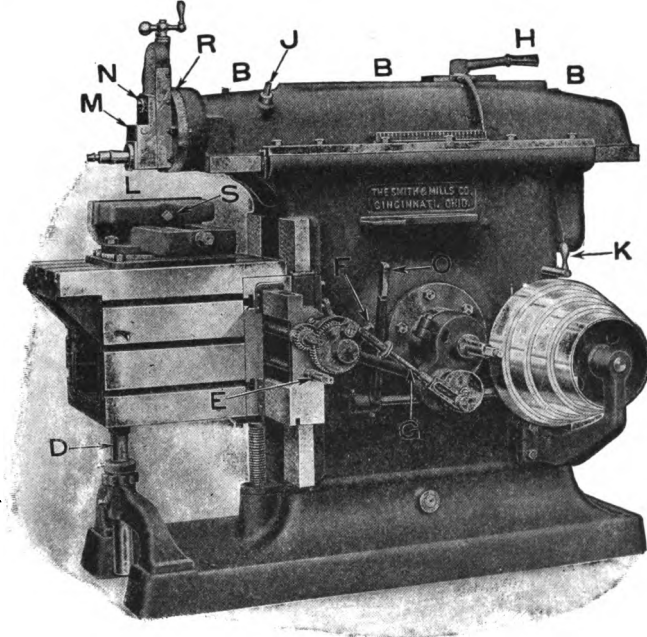


FIG. 13. TWENTY-INCH SHAPER

**Problem 2.—Planing One Surface Square With Another.**

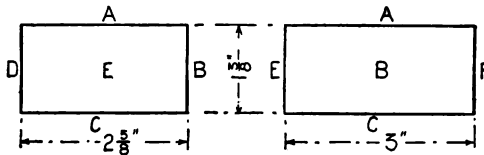


FIG. 14

**Sequence of Operations:**

1. Clamp in shaper vise and plane side D square with A and parallel with B.

2. Plane the ends E and F square with the sides A, B, and D.

In taking up the problem on the shaper it is assumed that the sides A and B of the cast-iron block in Fig. 14 have been finished true and square in the vise. The other sides are to be finished on the shaper to the dimensions given.

It may be somewhat easier to follow the instructions if the six sides of the block are lettered with a piece of chalk to correspond with the drawing.

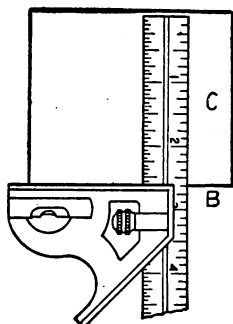


FIG. 15

First lay off the width of the side C with a scribe and combination square, as shown in Fig. 15, marking a line  $2 \frac{5}{8}$ " from the side B and parallel with it. In order to make the scribe marks plainly visible the surface should be chalked. This is especially necessary when the hard scale has not been removed.

**Clamping the Work in Vise.**—The work is clamped in the shaper vise with the finished side B resting on the base and with the side A against the stationary jaw of the vise, as in Fig. 16. A piece of paper should be kept under each end of B.

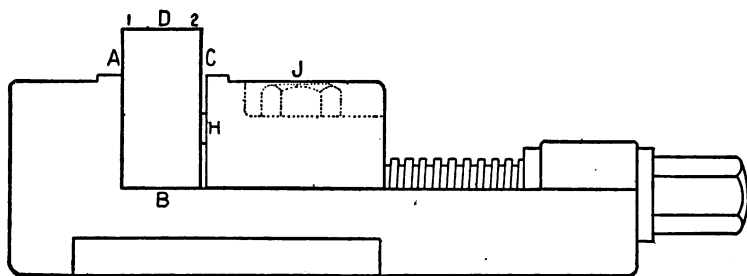


FIG. 16

The clamping bolt J may be left loose until the jaw is close to the work. It should then be tightened so that as the jaw is

screwed up against the work it will not be raised off the base of the vise.

The narrow metal strip shown at H should be about  $1/16''$  x  $1/2''$  x  $6''$ . It is used so that when the vise is tightened the pressure on the block will be about at the center. This holds the side A tight against the solid jaw. By rapping side D with a hammer, B is forced down on the base of the vise until the paper at both ends is tight. The work is now ready for the roughing cut.

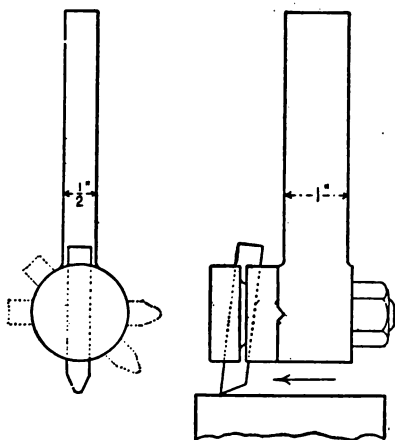


FIG. 17

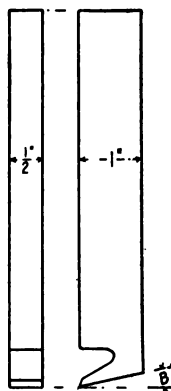


FIG. 18

**Roughing Cut.**—This is taken with a tool or bit similar to the one used on the lathe, but which has less clearance since it cuts along a straight line. The lathe tool holder is sometimes used on the shaper, but a regular shaper tool holder, Fig. 17, is preferred. The latter has an adjustable head or clamp so that the tool may be turned at different angles. The piece of tool steel used in such a holder should always be longer than the diameter of the head, otherwise it will not be held firmly.

**Depth of Cut.**—The depth of the roughing cut depends mainly upon the size of the machine and the amount of metal

to be removed. If  $1/8''$  is to be cut off take a little more than half that amount the first cut.

**Rate of Feed.**—This also depends largely upon the size of the machine. With large and heavy machines deep cuts may be taken and coarse feeds used.

If a small shaper is used, as is generally the case with work of this sort, the rate of feed with a cut about  $1/8''$  deep, may be about  $1/64''$ . With a cut only  $1/16''$  deep the feed may be increased to  $1/32''$  per stroke.

**Finishing Cut.**—The finishing tool, Fig. 18, is forged from a piece of carbon steel. Care should be used in grinding it not to draw the temper. The advantage of using carbon steel instead of high-speed steel for this tool is that it makes a smoother finishing cut and is cheaper and easier to forge. The cutting edge should be ground as straight as possible. It may be a little convex but never concave. The clearance angle B should be about  $10^\circ$  or  $15^\circ$ .

**Setting the Finishing Tool.**—In order to take a smooth finishing cut, the tool should be set with the cutting edge parallel, or nearly so, with the surface to be planed. This is done by clamping it loosely in the tool post and over but not touching the work. If the cutting edge is not parallel with the work, rap the tool until it appears to be so. Feed the tool down with the hand crank until it just touches the work. Now move the ram of the shaper forward by pulling the belt by hand. The fine chip or dust removed by the tool will show if it is set in the proper position.

**Direction of Feed.**—If the tool appears to cut deepest at the center, it may be fed in either direction, Fig. 19, but if it is set so that one side cuts slightly deeper than the other, as in Fig. 20, the direction of the feed should be as indicated by the arrow. Feeding in the opposite direction is apt to make the tool chatter because of the wide cutting edge that is in contact with the work.

The curve of the cutting edge in Fig. 19 and the angle at

which the tool is set in Fig. 20 are greatly exaggerated. The cutting edge should be straight within .002" or .003" and one side should not be set more than .002" or .003" deeper than the other.

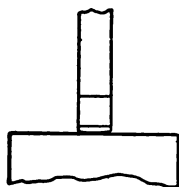


FIG. 19

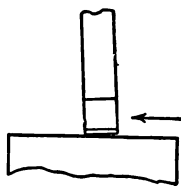


FIG. 20

#### **Depth of Finishing Cut.—**

The finishing tool is intended for shallow cuts of not more than .01" and works better if still less is taken. In general practice it is customary to plane to the finish line with a roughing tool

and use the finishing tool merely to remove the marks of the roughing tool. If .02" or .03" are to be removed several cuts should be taken.

**Rate of Feed.**—As the finishing tool has a wide cutting edge a coarse feed may be used. In this case about 1/8" per stroke will do. With most shapers this is about equivalent to one-half turn of the hand crank. The feeding should be done by hand and care taken to note the position of the crank after each turn. This insures a uniform rate of feed.

**Cutting Speed.**—The cutting speed should be determined by experience. In most cases, however, 40 to 50 strokes per minute will give good results for both the finishing and roughing cuts.

**Testing the Work for Squareness.**—After roughing and finishing cuts have been taken, the work is removed from the vise and tested with a square to make sure the surface being machined is square with A and parallel with B. The work must be tested, because the solid jaw of the vise cannot be depended on as being square or the base upon which B rests as being parallel to the travel of the tool.

A pair of calipers is used to determine if the sides D and B are parallel.

**Resetting Work.**—In case D is not square with A the

setting in the vise may be corrected, within certain limits, by having the metal strip H, Fig. 16, higher or lower. When this strip is near the top of the vise the block will be very slightly tipped so that the edge 2 will be a little higher than 1. With H at or close to the bottom the effect will be just the opposite and a little more metal can be cut off at edge 1 than at 2.

If the two sides B and D are not parallel additional pieces of paper may be placed under the thickest end.

It may be necessary to take several trial cuts before the block is properly set in the vise. These cuts should be taken with the finishing tool since it is quickly fed across the work and does not remove much metal.

The work is now machined to the finished size. If it is necessary to remove more than  $1/32''$  of metal, time will be saved by first using the roughing tool, as the finishing tool is not intended to take more than  $.01''$  per cut.

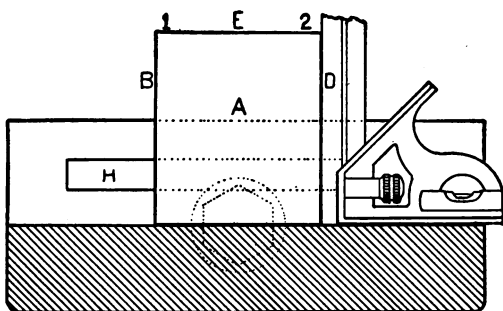


FIG. 21

**Planing the End.**—To plane the end of the block it is held in the vise in the same manner as when planing side D. It is first set approximately straight by using the square as in Fig. 21. In this view the solid jaw of the vise is not shown.

The base of the vise cannot be relied upon to be parallel with the travel of the tool, so that a trial roughing and finish-

ing cut should be taken to test the squareness of the surface E with the sides B and D.

In order to test side E with B and D it will be necessary to slide the blade of the square thru the head so that it may be used as a try-square. In this case the testing may be done without removing the work from the vise.

If the block is not set square it may be tilted a little in the vise by holding the grain end of a piece of wood against one corner and rapping the wood with a hammer. Most machinists, however, prefer the following method: If it is desired to plane off a little more at 1 than at 2, Fig. 21, rap down on the end 2 with the face of a hammer; this will cause it to settle a little deeper in the vise or the end 1 to rise.

By placing the fingers on the side of the block so that they are in contact with the work and vise at the time it is being rapped one can determine to some extent by the feeling the amount the work is being moved.

Care should be taken when rapping not to mar the surface so deep that the marks will show after the work is finished.

Another trial cut should now be taken and the process repeated if it is not square.

**To Prevent Corners from Breaking.**—It will be noticed that both the finishing and roughing tools break off the corner of the work at the outer end of the cut. To prevent this the corner is filed off at an angle of about  $20^{\circ}$  with the surface being planed, and as deep or slightly deeper than the finishing cut is to be.

On work of this size the corner should be filed off when the surface has been planed to within  $1/32''$  or  $1/16''$  of the finished size. The important thing is to be sure to file off the corner before it breaks out deeper than the finished size.

After this end is finished reverse in vise and plane end F to the size given in the drawing.

**Problem 3.—Planing One Surface Parallel With Another and Planing Angles.**

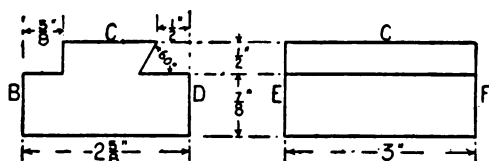


FIG. 22

**Sequence of Operations:**

1. Lay off on one end of block the outline of the finished piece.
2. Clamp in vise, Fig. 23.
3. Plane side C to size with roughing and finishing tools.
4. Rough out the angles with a roughing tool, Figs. 24 and 25.
5. Finish the angles.

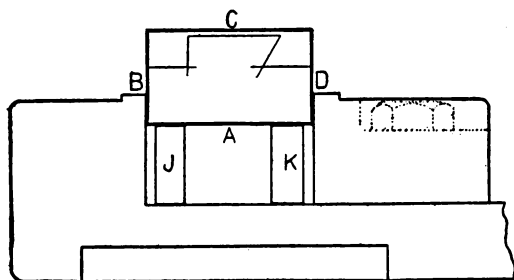


FIG. 23

In laying off the outline of the finished piece the combination square can be used for the measurements and to mark the 90° angle. A thread gauge or a bevel protractor is used for the 60° angle.

**Clamping in Vise.**—The work is clamped in the vise as shown in Fig. 23. The parallels J and K are longer than the

work and high enough so that the jaws of the vise grip on about  $1/2''$  of the work. The object in clamping on only a small area of the sides is to make it easier to rap the work down on the parallels.

Clamp the work tight, and rap the top with a hammer to force it down tight on the parallels.

Care should be taken before clamping the work that the movable jaw is tight on the base. If it is loose it will be impossible to rap the work down solid on the parallels.

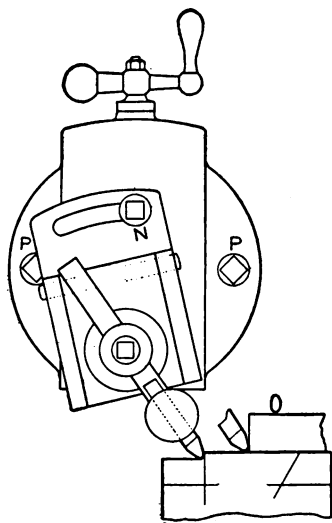


FIG. 24

**Planing One Side Parallel with Another.**—After taking a roughing and finishing cut, caliper the block at each corner to see if it is uniform in thickness. If one corner is thicker than another, place one or more pieces of paper under that corner and take another trial cut. This operation is repeated until the sides A and C are parallel. Then finish side C to size.

**Roughing Out the Angles.**—The angles are roughed out

with the regular roughing tool, cutting as close to the lines as possible. These roughing cuts should be heavy so as to remove the metal quickly. The tool should be started at the outside and fed toward the center. If the automatic feed is used it should be disengaged when the tool is within about  $1/16''$  of the finish line, and the feed continued by hand. When roughing out the angles, set the head, clapper box and tool as in Figs. 24 and 25.

**Setting the Head, Clapper Box, and Tool.**—For the  $90^\circ$  angle loosen the clamping screw N, Fig. 24, and move the clapper box to about the angle shown. The side of the tool should be nearly vertical, as at O.

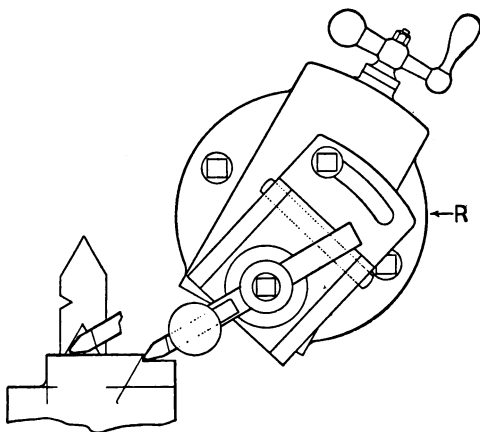


FIG. 25

Setting the clapper box at this angle causes the tool to swing away from the vertical side of the work on the return stroke of the shaper. If it were set at the opposite angle it would swing into the work.

For the  $60^\circ$  angle set the head to an angle of  $30^\circ$  with the vertical, using the graduations on the quadrant of the head R, Fig. 25. Move the clapper box to about the angle shown. It

should be noticed that the angle at which this is set is just the opposite of the one used when cutting the 90° angle. This is because the tool is to cut on the opposite side.

**Finishing the 60° Angle.**—The tool for finishing the angle is ground a little less than 60°, and with cutting edges on the side and bottom L and M, Fig. 26.

First adjust it so that the bottom is nearly parallel with the top of the block as at I in Fig. 27, being sure that the point is slightly deeper, say, about .001", than the rest of the tool. To prove that this is so, pull the belt by hand with the tool just touching the work. The deepest part of the tool will remove a small chip or some dust.

Move the tool to the side of the angle at G and feed it down with the hand crank to remove the round corner left by the roughing tool. Finish the bottom by feeding the tool from the outer edge into the corner. The point of the tool being set deeper insures the full depth of the cut to the sharp corner.



FIG. 26

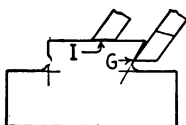


FIG. 27

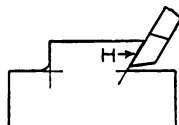


FIG. 28

Start a cut from the top of the 60° angle and feed down to the bottom. Now adjust the tool so that it is nearly parallel to the side as at H in Fig. 28, being sure that the point cuts the deepest. Take a finishing cut, beginning at the top and feeding down until the point just touches the bottom.

This tool, like practically all finishing tools, should be kept sharp by grinding and oilstoning. It should not be used for cuts of more than .01" in depth.

**Finishing the Right Angle.**—When the 60° angle has been finished, the 90° angle is finished in about the same manner. The head must be returned to its vertical position and the

clapper box tilted as in Fig. 24. The tool used is ground a little less than  $90^\circ$ , Fig. 29.

The bottom, or base of the angles, S and T, Fig. 29, should be finished to the same level. To do this the tool is set so that it just touches the surface T. The final finishing cut is then taken on S without changing the height of the tool.

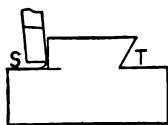


FIG. 29




FIG. 30

**Filing the Angles.**—After the angles are machined they may be finished smoother with a file. A 10" smooth square file with a safe edge may be used for the right angle as at U, Fig. 30, and a 10" smooth half-round file for the  $60^\circ$  angle. The latter should have a safe edge at V so it will not cut into the side when filing the bottom.

## Questions—Chapters I and II

1. Why do we chip and file a surface by hand instead of using a machine?
2. What kind of chisels are used for chipping a flat surface?
3. Why should the outer surface of cast iron be removed before filing?
4. Describe the different kinds of files in common use.
5. Why should care be exercised in grinding a scraper?
6. Why are scrapers oilstoned?
7. Describe the principal parts of a shaper.
8. Why is high speed steel used for a roughing tool and carbon steel for a finishing tool?
9. Should a coarse or fine feed be used when taking a finishing cut?
10. How deep a cut should be taken when using a finishing tool?
11. In problem 3, why is the outline of the finished piece laid out on the end of the block?
12. What are parallels used for?
13. Why is the clapper box set at an angle when using the vertical feed?
14. When planing the 30° angle, why is the head set at this angle?
15. When finishing angles, how is the tool set so that it will cut a smooth surface and a sharp corner?

## CHAPTER III

### DRILLING

**The Drill Press.**—The size of a drill press is determined by the maximum diameter of the work which can be centered with the spindle. Hence on a 16" machine the distance from the center line of the spindle to the column is about 8".

Fig. 31 shows a 20" complete drill with back gears. It has 8 changes of speed, ranging from 25 to 300 revolutions per minute. The back gears are located at the top of the machine and are shifted by means of the lever shown directly beneath them. This machine has both hand and automatic feeds and is also provided with an automatic stop for drilling a number of holes of the same depth.

When work is clamped to the table of the machine, it may be moved to any desired position for drilling by rotating the table and swinging the table arm about the column. To hold the table in position the wrench shown underneath it and a similar one on the column are tightened. The table may be raised or lowered by means of the hand crank on the column.

The drills used in this machine generally range from 1/4" to 1 1/2", but larger or smaller ones may be used. In most shops, however, light high-speed machines are used for small drills and heavier machines for the larger sizes.

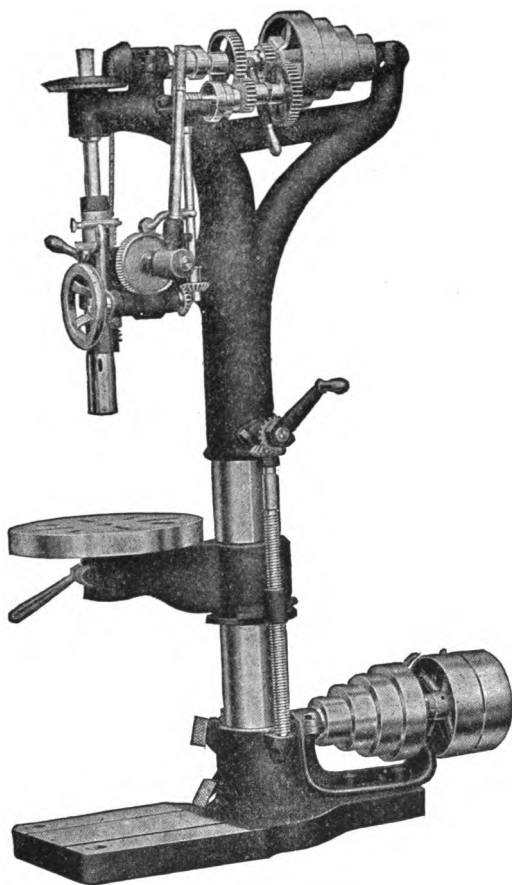


FIG. 31  
TWENTY-INCH COMPLETE DRILL

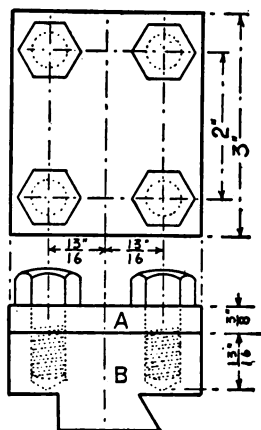


FIG. 32

**Problem 4.—Drilling and Tapping.**

Piece A is an unfinished cast-iron plate.

Piece B is Problem 3.

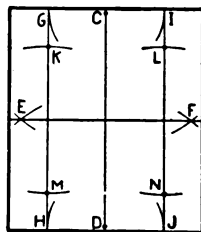


FIG. 33

**Sequence of Operations:**

1. Grind the rough surfaces of piece A.
2. Lay off the centers for holes in piece A.
3. Drill  $1/2''$  holes in piece A.
4. Place A on B and scribe position of holes on B.
5. Drill B with  $13/32''$  drill  $13/16''$  deep.
6. Tap holes in B with  $1/2''$  U. S. S. plug tap.
7. Tap bottom of holes with  $1/2''$  U. S. S. bottom tap.
8. If screws bind in holes of piece A, file with round file.

**Grinding Piece A.**—As it comes from the foundry the cast-iron piece A is usually rough. It should be smoothed up on the grinding wheel before laying out the holes.

**Laying Out the Centers of the Holes.**—Piece A being a rough and unfinished casting, is not apt to be square or true to size. It is therefore advisable to first mark the center lines CD and EF, Fig. 33.

To do this the surface is first chalked to make the lines plainly visible. Mark C and D at the center of the two ends and as close to the ends as possible. Center punch them with

a small center-punch and draw a line between them. With a pair of dividers and with C and D as centers describe the arcs which locate E and F. The line thru these two points will be at right angles with CD and at its center.

Next mark with the dividers on each side of CD half of the total distance between the centers of holes and draw GH and IJ. From EF mark off on these lines the required spacing of the holes K, L, M, and N.

To prove that the hole centers are laid out square, measure the distance from L to M and from K to N with the dividers. Check the layout with a rule to see if the centers are the correct distances apart.

When the intersections are in the right positions for the hole centers, mark them with a small center-punch. Now scribe circles about these points a little larger than the size of the holes to be drilled so that after drilling it may be seen if the hole is in the right position.

**Holding the Work**—This problem being small in comparison with the holes to be drilled, should be clamped to the table of the drill press, Fig. 34, or held in a drill vise, Fig. 35. When the former method is used, the work should be placed so that the drill is above one of the slotted holes in the table. The object of this is to avoid drilling into the table. In using the vise, the parallels should not be directly under the drill.

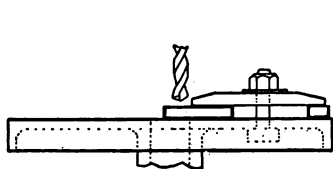


FIG. 34

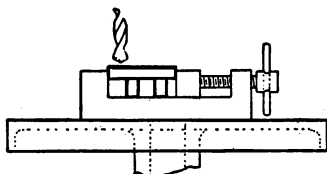


FIG. 35

If the holes were small, say less than  $1/4''$ , or the casting larger, it could be held by hand. In this case the work should rest on a piece of wood. Since the wood is soft the work is

less liable to slip out of the hand than when placed on the smooth surface of the drill-press table. The slipping does not usually occur until the point of the drill pierces thru at the end of the hole. Then it will slip unless held firmly.

**Selecting the Drill.**—Drills are usually designated by their size and the shape of their shanks. The size refers to the diameter of the drill. The shank is the end of the drill by which it is held in the machine.

The common drill sizes as listed in most catalogs run from  $1/16''$  to  $3''$ , varying by  $1/64''$ . The sizes usually found in shops, however, run about as follows:  $1/16''$  to  $1/2''$  by  $1/64''$ ,  $1/2''$  to  $1''$  by  $1/32''$ ,  $1''$  to  $2''$  by  $1/16''$ .

Drills are also made in number and letter sizes. The number sizes run from No. 1, which is  $.2280$  in diameter, to No. 80, which is  $.0135''$  in diameter. There are 80 different sizes. The letter drills range from A, with a diameter of  $.234''$ , to Z, which is  $.413''$  in diameter, and are 26 in number.

The shank of the common drill is either straight or tapered. When straight it is held in the machine with a drill chuck.

Taper-shank drills are held in the spindle as shown in Fig. 36. The tongue, or tang, of the drill, A, fits into a slot at the end of the taper hole in the spindle and makes the drill rotate with the spindle. The tapered shank keeps the drill from dropping out. To remove the drill from the spindle, a taper drift, B, is used as shown.

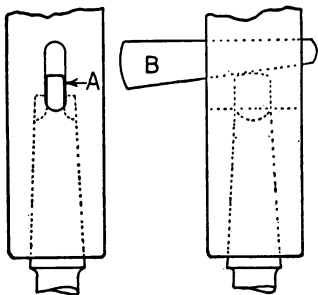


FIG. 36

The advantages of the taper-shank drill are that it runs true and is more conveniently held in the machine for large sized holes. Straight-shank drills larger than  $3/4''$  must be held in a chuck so large that it often interferes with the drilling.

In most shops drills up to  $3/16''$  diameter are used with straight shanks and those from  $3/16''$  to  $3/4''$  in diameter with either straight or taper shanks. Drills larger than  $3/4''$  in diameter usually have taper shanks.

Straight-shank drills cost less than those with taper shanks and are therefore used whenever possible.




FIG. 37

The steel sleeve or bushing shown in Fig. 37 is used when the shank of a taper-shank is smaller than the hole in the spindle of the machine. Sometimes when using small drills in a large machine it is necessary to use two or three of these sleeves.

After selecting the drill, examine the edges. If they are dull, sharpen them on the grinding wheel.

**How the Drill Should Be Ground.**—The common twist drill has two cutting edges, A and B, Fig. 38. Like other tools, these must be ground with clearance C in order to cut when the drill is forced into the metal and rotated as indicated by the arrow.

The cutting edges A and B should each make an angle of  $59^\circ$  with the axis of the drill. They should be of equal length in order to bring the point of the drill in the center. If the point is off center, only one edge of the drill will cut. This not only reduces its efficiency, but also produces a hole larger than is intended.

There are two methods of sharpening a drill, by machine and by hand. In shops where a great deal of drilling is required, a drill grinding machine is used.

**Hand Grinding.**—When it is necessary to sharpen a drill

by hand, and especially one that is larger than  $3/8''$ , a drill grinding gauge should be used, Fig. 39.

The cutting edge on smaller drills may be gauged by eye.

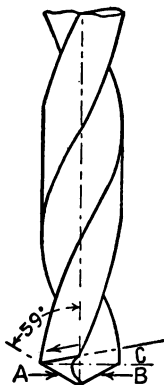


FIG. 38



FIG. 39

If the side of the grinding wheel is used instead of the periphery, it is easier to produce a good cutting edge.

**Speed of Drill.**—The speed of the drill depends upon its size, the material being drilled, and the feed used.

The following table will give beginners some idea of the range of speeds for different sized drills made of carbon steel.

Diameter of Drill	Revolutions per minute		
	Soft Steel	Cast Iron	Brass
$1/8$	850	1190	1770
$1/4$	390	565	855
$3/8$	265	370	412
$1/2$	200	260	370
$3/4$	112	168	265

Machinists do not, as a rule, consult a table for drill speeds because the hardness of the material varies, and drilling machines are not usually calibrated for the spindle speeds. It will therefore require some practical experience before a beginner can properly determine the speeds for different sizes of drills.

**Centering the Drill.**—There are two common methods that could be used for centering the drill in piece A. In either case the center-punch mark should be enlarged to about  $1/16''$  in diameter.

The first method is to drill a small hole about  $1/8''$  in diameter and  $3/16''$  deep. This hole acts as a guide for the  $1/2''$  drill and insures its being in the correct position.

In the second method a  $1/2''$  drill is used to make a countersink in the work about  $1/4''$  in diameter. If this countersink is not in the center of the circle, chip a small groove on the side that is farthest from it, as in Fig. 40, with a round-nose chisel or center gouge. Drill a little deeper and if the countersink still does not center, repeat the operation.

In either method the drill must be centered before it cuts to its full size.



FIG. 40

**Laying Off Holes in Piece B.**—After the holes have been drilled in piece A, place it in position on B. With a scribe lay out the circles on B by marking thru the holes in A.

**Drilling Piece B.**—The holes in piece B should be drilled a little larger than the diameter at the bottom of the threads of a  $1/2''$  tap. This is  $13/32$  of an inch.

Center punch the center of the circles as accurately as possible by eye. The drill should be centered by the second method described above.

**Drilling a Fixed Depth.**—The desired depth of hole may be obtained with the aid of the graduations on the spindle of the the drill press. In case the spindle is not calibrated a mark may be made on it with a piece of chalk to indicate when the desired depth has been reached.

## CHAPTER IV

### TAPS AND DIES

**Use of Taps.**—Taps are used to make inside threads; they may be used by hand or in a machine. They vary in size to correspond with the standard screws. Students who wish to study the different standards are referred to any machinist's supply catalog which will give a complete list of all standard screws, taps, and dies.

**Hand Tapping.**—Clamp the work in the bench vise and tap the holes, first using a 1/2" plug tap, Fig. 42. Then a 1/2" bottoming tap, Fig. 43.



FIG. 41



FIG. 42



FIG. 43

The plug tap is started by pressing down on it and turning it with the tap wrench shown in Fig. 44. After the tap has entered deep enough to cut a full thread, in this case about 5/16" deep, it is no longer necessary to press down on it as the tap will then draw into the work when turned.

A tap will work better if it is turned backwards occasionally, say 1/8 of a turn, instead of turning it continuously in one

direction. The tap wrench for this size tap should be about 12" long.

Lard oil should be used for a lubricant when tapping cast iron or steel. Brass is usually tapped dry.




FIG. 44

The accuracy with which a hole is tapped depends upon the operator, as the tap will not follow the hole. The tap should therefore be started square with the face of the work. In some cases this may be judged by eye, but it is usually necessary for beginners to use a square or the blade of a square, as in Fig. 45. In this case the blade is placed back

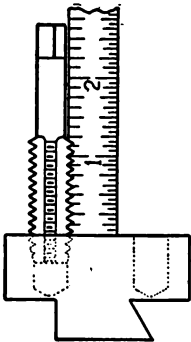


FIG. 45

of the tap and away from the hole. The tap is squared up by bringing its shank parallel with the edge of the blade. If the blade were placed over the edge of the hole, the small ridge produced by the tap would tip it out of square. The tap must be squared before it cuts to its full diameter, as any attempt to straighten it after that is liable to break it.

As the plug tap is tapered at the end, it will not cut the full size of thread to the bottom of the hole. It is desirable on account of strength to have the length of the full threads greater than the diameter of the screw. The tapping should therefore be finished with a bottoming tap which will cut full threads nearly to the bottom of the hole.

The reason for not using the bottoming tap for the entire tapping operation is that it is practically impossible to start such a tap.

.If the holes extended all the way thru, the taper, tap Fig. 41 would be preferred by some mechanics as it starts a little easier than the plug tap.

**Filing Holes in Piece A.**—In case the holes in piece B do not match up exactly with those in A, the screws will bind or

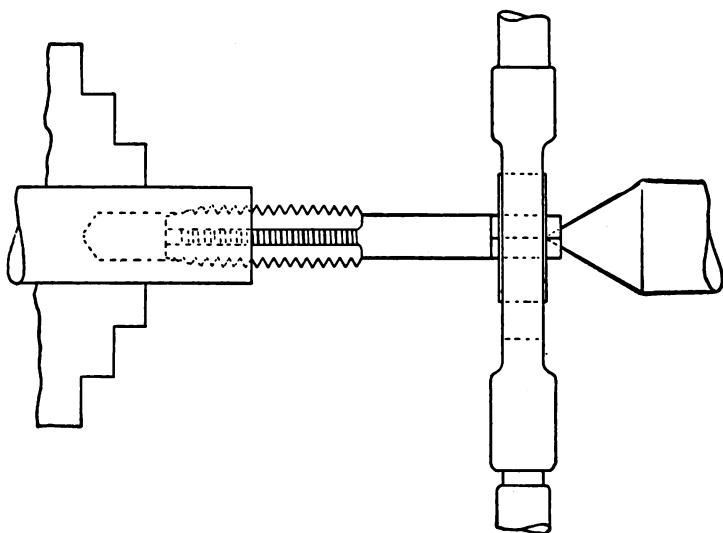


FIG. 46

will not go in at all. It is then necessary to file the holes in A with a round file until the screws no longer bind.

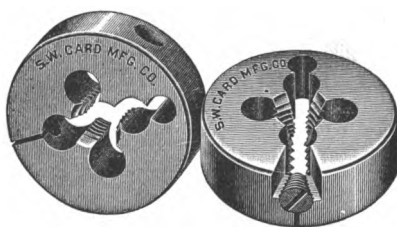


FIG. 47. DIES

To conserve time, file only that part of the hole which binds on the screw.

**Machine Tapping.**—Work is often tapped in the lathe as in Fig. 46. Here a hole is tapped in the end of a shaft. The tap is usually turned by hand and as it is drawn in the hole is

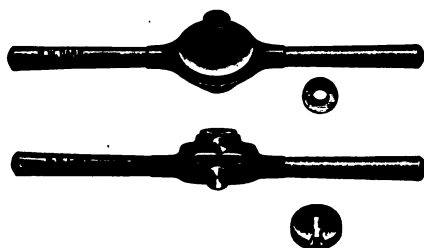


FIG. 48

followed up with the tail-stock center. The center supports the end and insures true work.

To prevent the spindle of lathe from turning, lock it by engaging back gears.

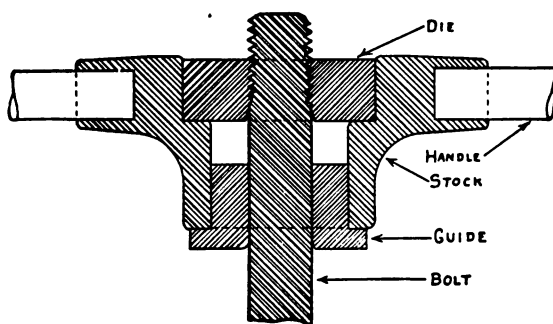


FIG. 49




FIG. 50

**Use of Dies.**—Dies, Fig. 47, are used to produce outside threads, as in threading bolts, etc. Like taps they are made in

sizes to correspond with standard screws and bolts. They may be used in a machine or by hand very much the same as taps. In both cases a lubricant is used

Fig. 49 shows the hand application. The die is held in the die stock, Fig. 48, by a set screw. The guide or bushing insures cutting the threads approximately true.

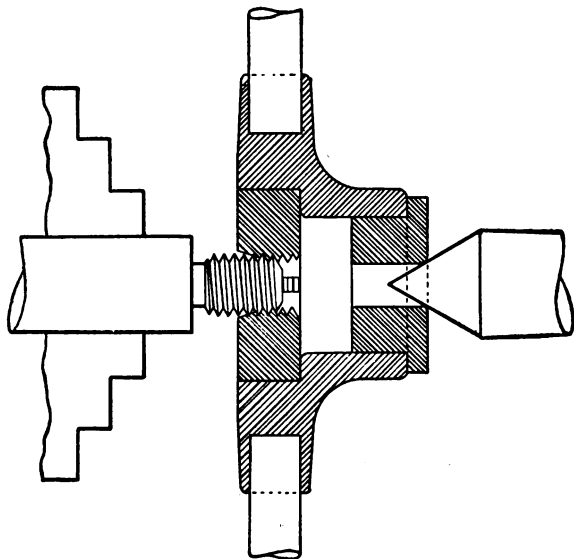


FIG. 51

It will be noticed that the threads on one side of the die have more taper than the other; this is the starting side. Where threads are to be cut close to a shoulder, as in Fig. 50, it is first threaded with the die in the stock, as in Fig. 49, using a  $\frac{3}{4}$ " guide and  $\frac{1}{2}$ " die; then by reversing the die a full thread may be cut close to the shoulder. The die stock for this size die should be 12" or 14" long.

Fig. 51 shows the common method of using the die in the lathe. Work can be threaded quickly with a die but the

threads will not be as true as when cut with a threading tool.

Dies are less liable to break when used in the lathe than are taps; therefore they may be used with power or by hand. When using the power the lathe should run slowly.

## CHAPTER V

### LATHE WORK

**Descripton of Lathe.**—The lathe, Fig. 52, has a constant-speed drive, and it may be driven with a belt running from a countershaft or from a line shaft to the pulley 1, or from a motor mounted upon the headstock. A lathe of this type is called a selective-head lathe.

The principal advantages of this kind of a lathe as compared with one driven with a cone pulley are that the change of speed is more quickly and easily made, and it is more powerful.

The driving pulley 1 is connected to the live spindle by change gears. To obtain the 12 different spindle speeds the gears are shifted with the levers 2, 3, 4.

The spindle of this lathe is different from most lathe spindles in that the threads which receive the chuck or face-plate are cut inside the flange or collar 5, instead of on the outside of the end or nose of the spindle. The nose 6 fits a corresponding hole in the chuck or face plate and is of such length that the chuck is guided true when screwed on, thus eliminating the danger of crossing the threads.

The levers 26, 27, and 28 control the gears that are used for thread cutting and for the feed. This feature is called the quick-change gears. The threads and feeds that the lathe will cut and the corresponding positions for the levers are registered on the index plate 25. This device is much quicker and more convenient than taking off and putting on gears as is the case with the lathe shown in Fig. 73, page 60.

The levers 29 and 30 are fastened to the same shaft and are used to start, stop, brake, and reverse the lathe. The reason there are two levers for this purpose is so that the operator can control the lathe while standing either in front of the carriage or at the end of the lathe when changing the gears.

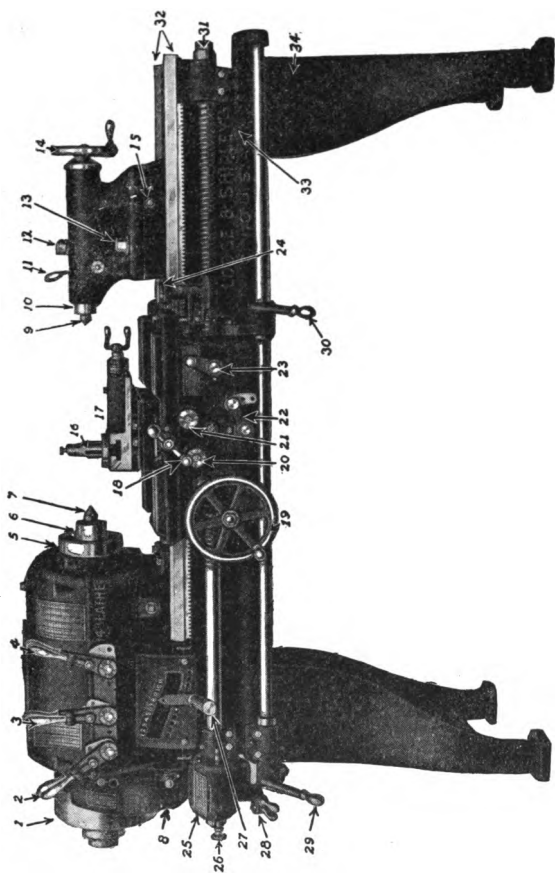


FIG. 52. FOURTEEN-INCH SELECTIVE-HEAD LATHE

## PARTS OF LATHE

The selective-head lathe has practically all the parts that a cone-pulley lathe has except the back gears and the cone pulley.

### Head-Stock Group

1. Driving pulley.
- 2, 3, 4. Levers for changing spindle speeds.
5. Flange of spindle threaded on the inside to receive face plate or chuck.
6. Spindle nose.
7. Live center.
8. Lever for reversing lead screw.

### Tail-Stock Group

9. Tail-stock center, also called dead center.
10. Tail-stock spindle.
11. Lever for clamping tail-stock spindle.
- 12, 13. Bolts for clamping tail-stock to bed.
14. Hand wheel for adjusting tail-stock center.
15. Adjusting screw which together with one on the opposite side controls the alignment of dead center with live center.

### Carriage Group

16. Tool post.
17. Compound rest.
18. Cross-slide hand crank.
19. Carriage hand wheel.
20. Longitudinal-feed clutch knob.
21. Cross-feed clutch knob.
22. Lever which controls direction of feed. This lever should always be in the center or neutral position when cutting threads.
23. Lever for connecting carriage with lead screws when cutting threads. This should never be thrown in if the feed lever 22 is in the top or bottom hole.

24. Graduated dial. By its use there is no need of reversing the lathe when cutting threads.

### Other Parts

25. Index plate.

26, 27, 28. Levers which control change gears for thread cutting and feed.

29, 30. Levers for starting, stopping, and reversing lathe.

31. Lead-screw.

32. Ways upon which the carriage travels.

33. Lathe bed.

34. Lathe legs.

### Problem 5.—Fit Shaft to Collar—Running Fit.




FIG. 53




FIG. 54

### Sequence of Operations:

1. Cut off stock.
2. Center both ends.
3. Place work between lathe centers.
4. Finish the ends.
5. Turn shaft nearly to size.
6. Finish to size by filing.

Cut off with a power hack-saw a piece of steel  $6 \frac{1}{16}$ " long from a bar 1" in diameter. This will allow  $\frac{1}{16}$ " for finishing the ends and  $\frac{3}{16}$ " for turning the diameter.

An experienced lathe operator would use a piece of steel  $\frac{7}{8}$ " in diameter, but for beginners it is better to use larger stock to allow for practice turning.

**Centering.**—Center both ends in the centering machine. The size of the center in this shaft should be from  $\frac{3}{16}$ " to  $\frac{1}{4}$ " in diameter. Larger work should have deeper centers.

If a centering machine is not available, the work may be centered by first locating the center with a pair of dividers and center-punch and then using a combination drill and countersink in the lathe as shown in Fig. 55. Or it may be centered in the drill press. In both cases the work is held by hand to prevent it from turning. As this work is to be turned, it is necessary to center it only approximately true.

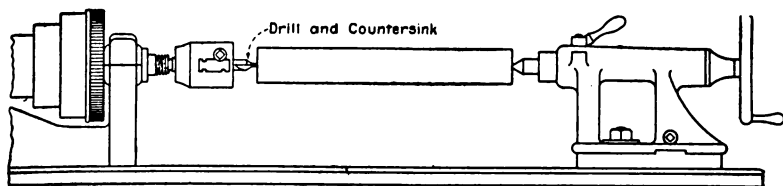


FIG. 55

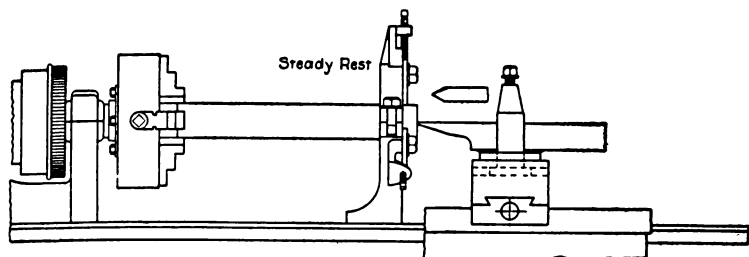


FIG. 56

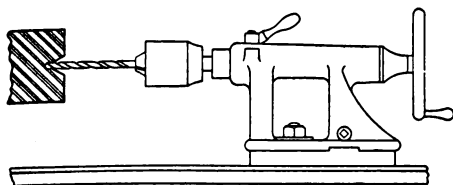


FIG. 57

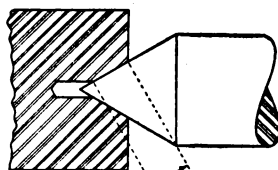


FIG. 58

**Accurate Centering.**—When the work is to be centered accurately, it may be done by putting one end in the lathe chuck and the other in a steady rest. A pointed tool is then

used in the tool post as shown in Fig. 56. The point of this tool has an angle of  $60^\circ$ , the same as the lathe centers, and is ground like a flat drill so that it cuts on both sides.

After the shaft is centered with this tool, a center-hole about  $1/8''$  in diameter should be drilled. This is done by holding the drill in the tail-stock of the lathe with a drill-chuck, as shown in Fig. 57. The object of this center-hole is to give the center of the shaft a bearing on the lathe center a short distance back from the point, as at A in Fig. 58.

**Placing Work in Lathe.**—The work is made to rotate on the lathe centers by fastening a lathe dog to the shaft at the head-stock end, as shown in Fig. 59.

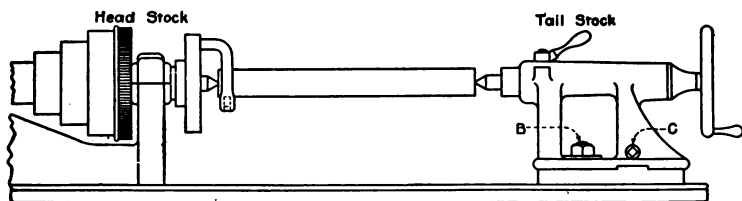


FIG. 59

There are a number of different sized dogs; the smallest size that will go over the shaft should be used.

The tail-stock center is adjusted so that the shaft will rotate freely, yet be tight enough to allow no slack, or lost motion. Since the shaft rotates on this center, it should be kept well lubricated by using machine oil, or a mixture of graphite and oil.

To get the best results in turning this sort of work, it is necessary to face both ends before turning and to rough-turn the whole piece to within about  $0.03''$  or  $0.04''$  of the finished size before any part of it is finished. However, it is not always necessary to do this. The object of first rough-turning the shaft all over is to remove the internal strains of the steel and to wear the centers down to a good bearing before any finish-

ing cuts are taken. The purpose of facing the ends is to get them square, or true, and smooth, and the shaft the proper length.

**Finishing End of Shaft.**—To face the ends, use a regular turning tool, starting to cut from the outside and feeding by hand towards the center with the cross feed. Such a tool will leave a ridge near the center, as shown in Fig. 60. This ridge is cut off with a sharp pointed, side-cutting tool, as shown in

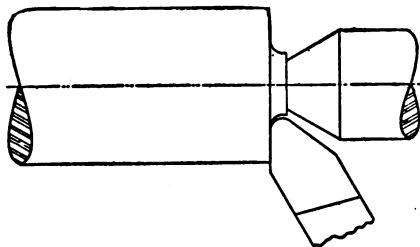


FIG. 60

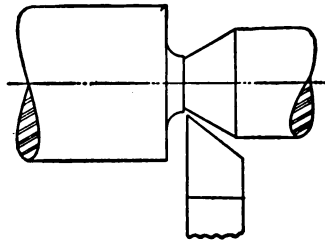


FIG. 61

Fig. 61, which is also used for taking the finishing cut across the whole end of the bar. When taking this finishing cut, lard oil, or some other lubricant, should be used. (See use of lubricant, page 57.)

After the finishing cut has been taken, any small ridge, or fin that remains at the edge of the center is removed by slightly changing the angle of the tool in the tool post and allowing about  $1/64$ " play between the centers. Having the work loose like this when the lathe is running, allows the extreme point of the side tool to extend beyond the edge of the center and cut a smooth end.

If the stock is cut off fairly true and close to size, it will not be necessary to use the round-nose tool shown in Fig. 60.

The lathe should run slowly for the finishing cut and fast when the regular turning tool is used.

**Turning the Shaft.**—The first, or roughing cut, is taken with a high-speed steel tool, or bit, fastened in a tool holder.

The tool holder is clamped in the tool post of the lathe so that the point of the tool is at, or a little above, the center, or axis, of the lathe, as Fig. 62.

If the point of the bit is too high, it is easy to see that, as the shaft rotates, the tool will not cut at all, Fig. 63. In case the tool is set below the center, the cutting action is very poor, therefore turning tools are never set as in Fig. 64.

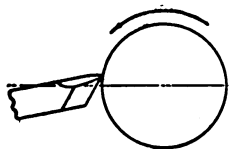


FIG. 62

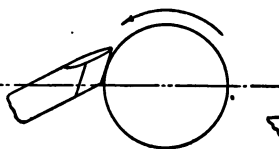


FIG. 63

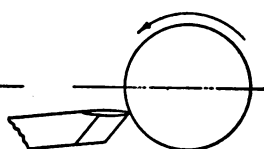


FIG. 64

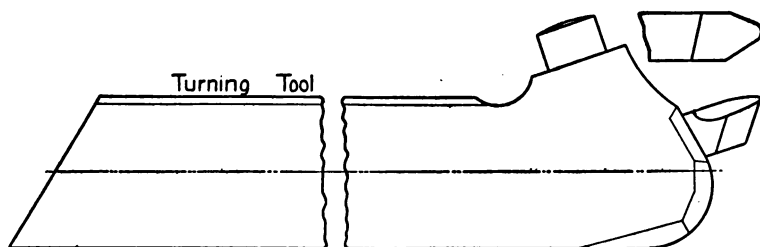


FIG. 65

**Speed of the Lathe.**—In taking the heavy roughing cuts, the belt may be placed on the second largest step of the cone, while for the finishing cuts the lathe should run a little faster, say with the belt in the next smaller step.

**Grinding Turning Tool.**—The front, or point, and the sides of the tool are ground at an angle, which is called the clearance. If the tool has too little clearance, it will not cut freely, while if it has too much clearance, the point will be so thin that it will break off or become dull quickly.

The top of the tool is also ground at an angle. This is called the rake. If the tool has too little rake, it will not cut

freely and if it has too much, the edge will soon break down.

It requires some practice for a beginner to learn the proper rake and clearance that should be given to a tool, Fig. 65 shows a tool ground with clearance and rake that will give very good results.

**Direction Tool Should Travel.**—The depth of the first cut should be about  $1/16''$  and the travel of the tool should be from the tail-stock end towards the head-stock. If the travel is in the opposite direction, the pressure on the tail-stock center is increased, causing it to heat quickly.

The length of the cut should be as great as possible without the lathe dog striking the tool, or cross-rest.

**Adjusting the Lathe to Turn Straight.**—After the first cut the work should be calipered, and if it is being turned tapering, the tail-stock should be adjusted so that the lathe will turn straight.

The tail-stock adjustment is made by loosening the main clamping nut B and one of the screws C and then tightening the other screw C on the opposite side of the tail-stock, Fig. 59.

If the shaft is larger at the tail-stock end, the tail-stock should be moved towards the front of the lathe one-half the difference between the diameters of the shaft at the two ends.

In doing close work, the tail-stock should be adjusted as closely as possible, but in this case if it is off-center only a little, say  $0.002''$  or  $0.003''$ , it will be close enough providing it is set so that the shaft will be turned larger at the head-stock end. If the tail-stock is set so that the shaft is turned larger at the tail-stock end, the shaft will be too small at the other end after the finishing cut is taken.

**Fitting Shaft to the Collar.**—After the roughing cut is taken and the lathe has been adjusted so that it turns approximately straight, the end of the shaft is turned for about  $1/4''$  so that it will just fit the hole in the collar, shown in the drawing of Problem 5. To measure this: first set the inside calipers to the diameter of the hole in the collar, then set the outside

calipers to the inside calipers and caliper the shaft as accurately as possible. For a final test of this diameter, remove the work from the lathe and try it with the collar itself.

The advantage of turning but  $1/4''$  at the end of the shaft is this: if the finishing cut were set too deep, only  $1/4''$  of the shaft would be too small, while if this cut were taken the whole length, the entire shaft would be too small.

After the shaft has been turned at the end so that it fits the collar, the rest of the shaft should be turned a little larger, say  $0.002''$  or  $0.003''$  in diameter. This will leave enough to finish with a file.

**Finishing Cut.**—The tool used for the roughing cut may also be used for finishing, but it is usually necessary to resharpen it. After it is reset in the tool post, the point should be flattened a little wider than the pitch of the feed, say about  $1/32''$ , and parallel with the work. This is done with an oilstone.

**Filing.**—The object of filing is to take out the tool marks, but it is also found to be much easier to make a close fit by filing off the last  $0.002''$  or  $0.003''$  than to take so small a cut with a tool. The amount of allowance for filing depends upon the character of the finishing cut. Since the less filing required the better, the finishing cut should be made as smooth as possible.

For filing work on a lathe, a single-cut file is used. This is called a lathe, or mill file.

The stroke of the file should be slow, steady, and straight across the shaft. The lathe should run a little faster for filing than for turning, the object being to have the work make several revolutions for a single stroke of the file. If the lathe runs too slowly and the stroke of the file is too fast, the shaft, instead of being filed round, will have a series of flat places on the surface.

After the work is finished as close to the dog as possible, reverse it in the lathe and finish that part where the dog was fastened.

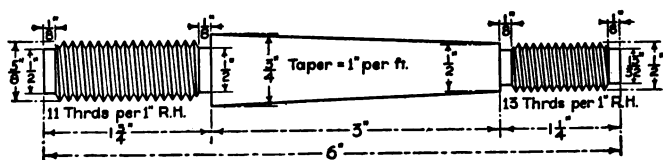
**Problem 6.—Turning and Threading a Taper Shaft.**

FIG. 66

**Sequence of Operations:**

1. Lay off the dimensions  $1 \frac{3}{4}$ ", 3",  $1 \frac{1}{4}$ ".
2. Turn the large end as shown in Fig. 68.
3. Turn the small end and the taper.
4. Cut threads and polish threads and taper.
5. Cut threads on large end.

The finished shaft in Problem 5 may be used for Problem 6.

Place the shaft in the bench vise and with a rule and scribe lay off the dimensions:  $1 \frac{3}{4}$ ", 3", and  $1 \frac{1}{4}$ ". Then center-punch the lines just deep enough so that they can be easily seen when the work is in the lathe, or enlarge them with the corner of a file.

Turn the large end first.

When it is necessary to turn a fixed distance, or to a line as in this case, it is well to disconnect the feed when the tool is within about  $\frac{1}{8}$ " from the end of the cut and to feed the tool the rest of the distance by hand. If this is not done, the tool may travel farther than it is intended to.

It is better to turn the portions to be threaded a little under rather than over size. For if they are over size, the threads will not fit the standard size nut, but if under size the threads do not need to be cut so deep in order to fit the nut.

For measuring the diameters of this piece set the calipers as accurately as possible by measuring from the end of the rule, as shown in Fig. 67.

**Use of Lubricant.**—A lubricant is a liquid used in producing a smooth finish when cutting steel and in some cases other metals. It is also used to prevent tools overheating when doing heavy duty.

Lard oil is generally considered the best lubricant, but owing to the high cost its use has been greatly reduced by substituting such compounds as soap water, soda and water, etc.

In making this problem a lubricant should be used on the following operations: cutting recess, chamfering and thread cutting.

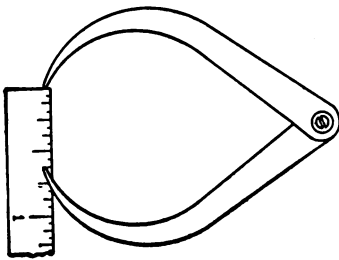


FIG. 67

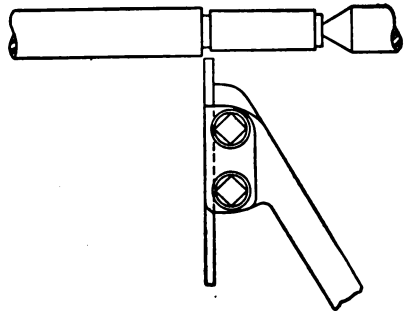


FIG 68

**Cutting Recess.**—The surface at the end as well as the recesses between the threads and the taper are cut with a square-nose, or cutting-off tool, Fig. 68.

This tool should have a sharp smooth edge, the point being set level with the center of the lathe.

After the end is turned to size, reverse the work in the lathe and turn the other end and the taper before cutting the threads.

**Turning Taper.**—The drawing calls for a taper of 1" per foot. This is cut by using a taper attachment, or by setting the tail stock off-center. As most lathes are not provided with

a taper attachment, the latter method will be used.

If the work were 12" long, the tail-stock would be moved off-center  $1/2$ " to turn a taper of 1" per foot. It being only 6" long, the tail-stock is set off-center but half that amount, or  $1/4$ ".

Before taking the finishing cut, caliper both ends to prove that the lathe is cutting the correct taper.

**Size and Shape of Threads.**—The threads are cut to fit  $1/2$ " and  $5/8$ " nuts having United States Standard threads. These threads are flattened at the top and bottom to the amount of  $1/8$  of the pitch instead of being sharp pointed as in the case of Standard V-threads.

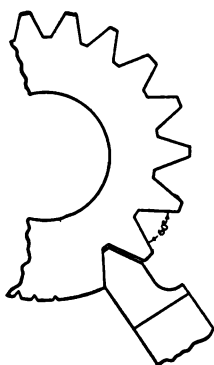


FIG. 69

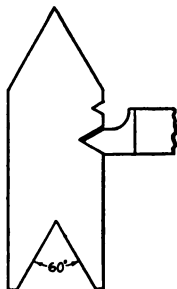


FIG. 70

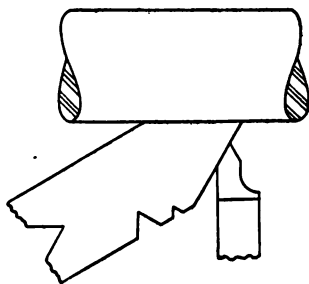


FIG. 71

**Pitch.**—The pitch of the thread is the distance from the center of one thread to the center of the one adjoining. On the end of the problem having 13 threads per inch the pitch is  $1/13$ ", so that the width of the flat at the top and bottom of this thread should be  $1/8$  of  $1/13$ ", or about .009".

**Lead.**—The lead of the thread is the distance a nut on the screw will travel in making one complete turn. For single threads the pitch and lead are the same, but for double threads the lead is twice the pitch.

**Grinding Tool.**—The sides of U. S. S. threads form an angle of  $60^\circ$ . To cut this thread in a lathe, a tool the same shape as the threads is used. A gauge for grinding this tool accurately is shown in Fig. 69.

If a U. S. S. thread gauge is not available, the tool can be ground with the aid of a regular thread and center gauge, shown in Fig. 70. With such a gauge the angle can be ground accurately, but it will be necessary to measure the flat point with a rule.

Where the thread to be cut is as fine as 13 per inch the flat

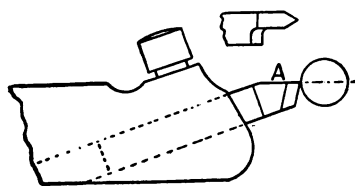


FIG. 72

surface at the point of the tool is so small that the extreme point can be oil-stoned off instead of being taken off with the grinding wheel. The flat point should never be wider than the standard size, but if it is a little too narrow it will make very little difference in ordinary lathe work.

The top of the tool A, Fig. 72, should be ground so that it will be approximately in a horizontal plane when set in the lathe.

**Setting Tool.**—To set the tool so that both sides of the thread will have the same angle, the thread gauge is used as shown in Fig. 71. The tool should be set on a level with the center of the lathe.

**How Lathe is Geared.**—To cut 13 threads per inch the work must make 13 revolutions while the carriage, which carries the tool, travels one inch. For this purpose the lathe spindle is connected to the lead screw with the proper size gears and the lead screw to the carriage by a split nut. This split nut is back of the carriage apron and is opened and closed by the lever E, Fig. 73.

If the lead screw of the lathe has 6 threads per inch, the

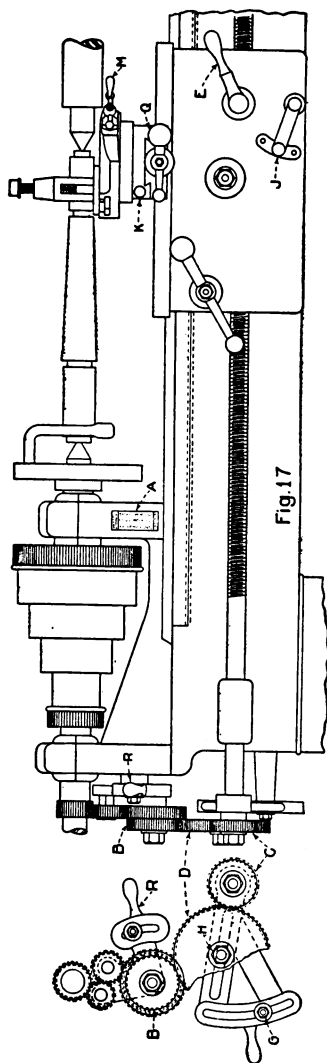


FIG. 73

- A. Index Plate
- B. Stud Gear
- C. Screw Gear
- D. Intermediate or Idle Gear
- E. Lever for connecting Carriage to Lead Screw
- J. Lever for Disconnecting and Reversing Feed
- K. Adjustable Stop for Thread Cutting

gearing to cut 13 threads per inch must have the same ratio as 6 is to 13. To cut 16 threads the ratio would be 6 to 16.

It is not necessary to figure the size of gears for the different threads as all lathes are provided with an index plate that designates the proper size gears to be placed on the stud B and screw C, Fig. 73, for the desired thread.

**To Set Change Gear.**—To change these gears, first loosen the nuts holding the stud and screw gears B and C. Next loosen the nut G. This will allow the intermediate gear to drop away from the stud gear B. Then loosen the nut H so that the intermediate gear can be drawn back away from the gear on the lead screw C. The gears may now be changed.

When the gears are put in mesh, they should be set so that there will be a little slack, or lost motion, between the different gears. If they are set too close together, they will make a great deal of noise when running and there is also danger of breaking the teeth.

While all lathes are not designed alike the method of changing the gears is very much the same on all machines except those having the quick change-gear device. With a lathe having such a device, instead of changing the gears on the stud and screw the same result is obtained by shifting a combination of levers.

**Why Feed Should Be Disconnected.**—The mechanism that controls the feed, or travel, of the tool when cutting threads is independent of that used for the feed when doing plain turning. The two feeds usually run at different speeds so that if they are both in action at the same time the gears in the carriage will break. For this reason all lathes are provided with some means of disconnecting the feed used for plain turning when cutting threads.

To disconnect the feed on the lathe shown in Fig. 73, move the lever J to the central, or neutral, position. This should always be done before starting to cut the threads.

**Speed of Lathe.**—The lathe should run slower for cutting

threads than for plain turning. With most lathes if the belt is on the largest step of the cone it will give about the right speed for cutting the threads in this problem.

The object of running the lathe slowly is to give the operator time to draw back the tool at the end of the cut and to obtain a smoother cut. If the speed of the lathe is too fast, the cutting action will be so quick that the tool, instead of cutting clean and smooth will tear out the metal, leaving a rough surface.

The slower the lathe runs the easier it is to cut the threads, but it will also take longer to do the job. It therefore requires practical experience to determine the proper speed to be used for cutting the different size threads.

**Chamfering.**—After the lathe and tool are properly set, chamfer off the sharp corners where the threads begin and end with the side of the thread tool. The depth of this cut should be about the same as that of the threads when finished.

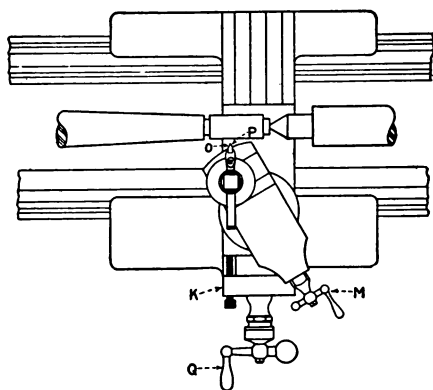


FIG. 74

If the corners are not chamfered, the threads, when cut, will form a very thin edge, or fin, at the ends.

**Use of Adjustable Stop.**—To regulate the depth of each cut

an adjustable stop is used as shown at K, Fig. 74. First move the tool so that the point just touches the work, then adjust the screw on the attachment K so that the cross-rest will not go in any farther. Now move the carriage by hand until the point of the tool is a little past the tail-stock end of the work; close the split nut on the lead screw with the lever E, Fig 73; and turn the screw on the attachment K so that the tool can be moved in just enough to take a very light cut.

Start the lathe and when the tool has reached the end of the cut back it out and reverse the lathe. By reversing the lathe the tool is returned to the starting point without disconnecting any of the gearing. The object of drawing the tool back is to prevent it from dragging on the work during its return.

The tool will never travel over the same path on the reverse as on the forward movement of the lathe on account of the slack, or lost motion, in the gears.

This first cut is taken to prove that the lathe is properly geared, so the work should be measured with a rule, or screw pitch gauge, or compared with a standard tap.

Adjust the screw at K until the tool can be moved in deeper for the next cut and repeat the operation until the thread is nearly finished. Then the tool should be reset so that it will cut on only one side at a time.

If the lathe has no adjustable stop the depth of cut can be regulated by the graduations on the crossfeed shaft near the hand crank.

**Finishing Side of Thread.**—When roughing out the threads, the tool cuts on both sides of the point since it is fed straight into the work. It is much easier, though, to finish the threads smooth if the tool cuts on one side only. If the lathe has no compound rest this is done by rapping the end of the tool holder so that it is turned in the tool post just enough to change the position of the point of the tool about .01" or .02".

To prove that the tool is set over the proper amount, turn

the lathe forward by hand a few revolutions, to take out all the slack, or lost, motion in the gears, then move the tool into the groove of the thread until one side just touches the side of the thread. The other side of the tool should then be about .01" or .02" away from the side of the thread.

After the tool is properly adjusted, set the stop K. The tool is then drawn back and the lathe reversed until the tool is at the end of the work ready for a cut. It usually requires several finishing cuts to take out all the rough marks left by the roughing cuts.

When this side of the thread is finished, the other side is finished in the same manner.

**Use of Compound Rest.**—If the lathe is provided with a compound rest, a somewhat different procedure is usually followed, since the rest can be set at an angle of  $30^{\circ}$  with the work, as in Fig. 74.

In this case the tool is moved in by turning the small handcrank M until the side at O has been cut to the proper depth. While making these first cuts, the stop K is merely used to bring the cross-rest to the same position each time. The tool is then drawn back slightly with the hand-crank M and the stop K adjusted so that the tool can be moved straight in by means of the hand-crank Q. This will finish the other side of the thread at P.

To determine when the thread is cut to the proper size the work is removed from the lathe and tested with a standard nut having U. S. S. threads.

It should be remembered that in order to cut a smooth thread the tool must be kept sharp and the work must be wet with a lubricant.

After the threads are cut on this end of the problem, it is reversed in the lathe and the other end threaded in a similar manner.

To prevent the screw of the dog from marring the portion already threaded, two nuts should be screwed on and the dog fastened to the nuts.

**How to Reset the Tool.**—When cutting threads of this size and larger, the tool usually becomes dull from taking the heavy roughing cuts. It is then necessary to resharpen it before taking the fine finishing cuts.

To reset the tool in the lathe first get the angles correct, as shown in Fig. 71. Then revolve the lathe forward by hand to take up slack in the gears and move the tool in close to the threads. If the tool is in a position so that it will cut too much off one side of the thread, it may be changed by disengaging the reversing gears with lever R, Fig. 73, and turning the lathe by hand. When the tool is in the proper position relative to the groove of the thread, the reverse gear lever R is reset.

In a case where the tool is off the desired position only a very little, it may be corrected by the rapping process.

If the lathe has a compound rest the tool may be brought to the correct position by turning the hand-crank M, Fig. 74.

It would be well for beginners to practice thread cutting on a piece of scrap steel before trying to cut them on the problem.

**Polishing.**—The taper may be polished with fine emery cloth and oil and the threads with the end of a soft piece of wood. The work should rotate at the highest speed possible, and loose on the lathe centers.

**Problem 7.—Boring and Turning Cast Iron—Finished All Over.**

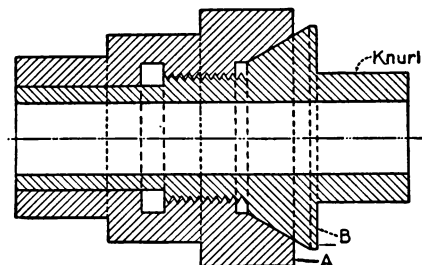


FIG. 75

**Sequence of Operations:**

1. Finish the inside of Piece A.
2. Drill and ream the hole in Piece B.
3. Mount B on mandrel and finish outside.
4. Screw A on B and finish the outside of A.

Piece A.

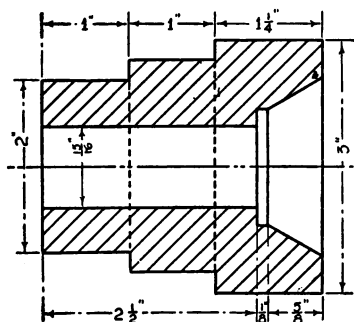


FIG. 76. ROUGH CASTING

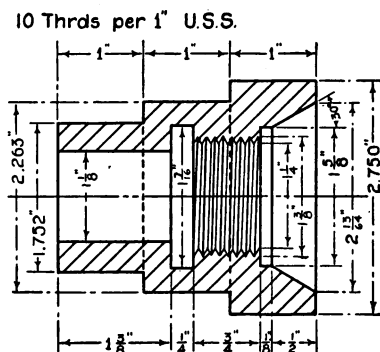


FIG. 77. FINISHED CASTING

**Use of Lathe Chucks.**—To machine the inside of piece A it will be necessary to hold it in a lathe chuck. There are two kinds of lathe chucks in common use, the scroll or universal three-jaw chuck and the independent four-jaw chuck.

The scroll chuck is self-centering, that is, the three jaws move to and from the center in unison. This chuck is used principally for holding finished bars of brass, steel, and other pieces when light cuts are to be taken. It is not suitable for holding rough and irregular pieces for heavy cuts as such work will spring the jaws and cause them to be out of true.

The independent four-jaw chuck is not self-centering, but is made heavy and strong; therefore, it is used for work that is not suitable for the scroll chuck.

As piece A is a rough casting and heavy cuts are to be

taken, the independent four-jaw chuck should be used for holding it, Fig. 78.

Work of this kind is usually chucked so that the outside

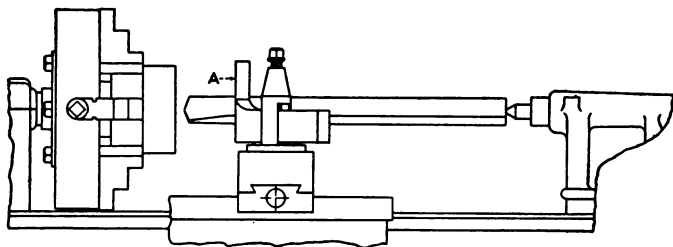


FIG. 78

surfaces will be within  $1/32''$  of running true.

The process of chucking the work is as follows:

**Centering Work in the Chuck.**—Place the work in the chuck and adjust the jaws until they are all at approximately equal distances from the circles on the face of the chuck. Then put a cutting-off tool loosely in the tool post and move it close to the work and as near as possible to the end of the chuck jaws. Revolve the lathe by hand to prove if the work is centered. If it is not centered to within  $1/32''$ , readjust the jaws until it is. Now move the cutting-off tool to the end of the work and turn the lathe by hand. If the end runs out of true, rap it with a hammer at such points as will correct its position.

**Advantage of Proper Chucking.**—Fig. 78 shows the work held by the middle step of the cone. One reason for holding it in this way is to permit the rough turning of the larger step while in the chuck. If the work were held by the small end, it would be apt to work loose when taking the heavy roughing cuts, on account of the distance that the work projects out and the small diameter on which the chuck grips compared with that of the large end which is to be turned.

**Rough Turning.**—After the work has been properly

chucked, rough-turn the end and the largest diameter to within  $1/32''$  of the finished size.

All cast iron has a hard surface, or scale, from  $1/64''$  to  $1/32''$  deep, so that it is necessary to run the lathe slower for the first cut than for those made after the scale has been removed. In taking this first cut the tool should be set deep enough to permit the point to cut under the scale.

**Speed of Lathe.**—The speed of the lathe in taking the roughing cut on work of this size should be about right if the belt is on the smallest step of the cone and the back gears are used. After the scale is removed, the lathe may be run faster.

A beginner will require experience before being able to determine the proper speeds and feeds for the different kinds of lathe work.

**Advantage of Roughing Inside.**—As the inside of piece A must fit the outside of the piece B, the  $1\ 1/8''$  hole, the threads and the taper must be machined true with each other, or else A will not fit into B properly. Now if the taper should be finished and the work moved in the chuck before the threads and the  $1\ 1/8''$  hole are finished, they would not be true with each other. For this reason it would be well to rough-bore the inside to within  $1/32''$  of the finished size before any of these three parts are finished.

**Roughing Inside.**—To rough-bore the taper use a regular turning tool. Set the compound rest to the correct angle and feed the tool in at that angle.

If the lathe is not provided with a compound rest, the taper may be rough-bored by turning both feeds by hand and following the cored surface as closely as possible.

The cored hole in the rough casting, Fig. 76 is  $15/16''$  in diameter which allows  $3/16''$  for finishing the  $1\ 1/8''$  hole and  $5/16''$  for the portion where the threads are to be cut.

**Use of Flat Drill.**—To rough-bore the hole a  $1\ 1/16''$  flat, or lathe, drill is used as shown in Fig. 78. The holder A is clamped in the tool post so that the slot in it will hold the

drill at the center of the lathe. If the drill is held above or below the center, the hole will be drilled larger than the drill. To prove that the slot in the holder is at the center, move it close to the tail-stock center. After the holder is properly set, move it as close to the work as possible and feed the drill into the work by turning the hand crank on the tail-stock.

If the cored hole is out of center, which is usually the case, the drill may wobble in the holder, thus drilling the hole off-center. To overcome this apply a wrench to the drill and hold it with the hand in such a way that the corners of the drill will cramp or bind in the slot of the holder. If the cross-slide of the lathe moves in and out when starting the drill, tighten the gib.

This drill removes the hard surface, or scale, and also trues up, or centers, the hole to within  $1/64''$  or  $1/32''$ . Now enlarge the portion of the hole where the threads are to be cut with a  $1\ 3/16''$  drill.

To determine when this drill has been fed in far enough, mark on the drill with a piece of chalk the distance from the end of the work to the point where the recess is to be cut. By sighting across the end of the work the operator can then see when the drill has been fed in the proper distance.

If a lathe drill is not available, a twist drill may be used, as in Fig. 86, page 75.

The advantage of the lathe drill is that it is cheaper and will center the cored hole better.

The hole may also be roughed out with a boring bar, although this will be a somewhat slower process.

**Use of Boring Bar.**—To cut the square shoulder where the threads begin and the recess where they end, use a tool and boring bar, as shown in Fig. 80, held in the tool post. The width of this tool is  $5/32''$ , so that it will be necessary to take two cuts to make the recess wide enough. Such a narrow tool is used because it is less liable to chatter.

This tool is ground with clearance at the sides as well as at the front, and it should also be noticed that it is wider at the cutting edge than back close to the boring bar. This is done so that when the tool is fed into the work there will be little or no chance of its binding on the side.

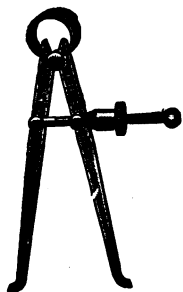


FIG. 79

To obtain the correct setting for the tool, move the boring bar into the hole and bring it up close to one side. The tool should then be adjusted until its cutting edge is parallel to this surface. It can also be set by comparing the side of the tool with the end of the work.

The recess and square shoulder may be finished smooth if the finishing cuts are very light, say .001" deep.

To measure the diameter of the recess use a pair of inside spring calipers, Fig. 79.

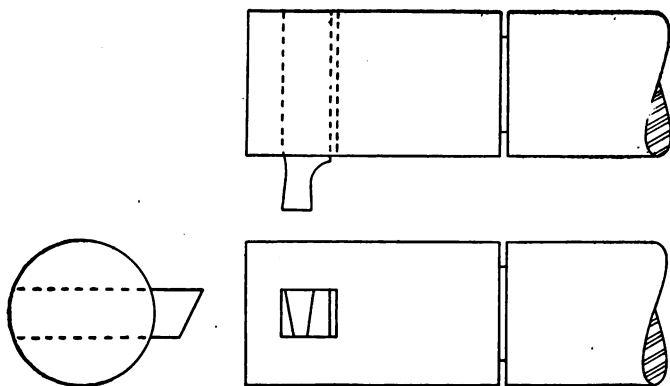


FIG. 80

The work is now all roughed out so that it makes very little difference which of the three fitting parts is finished first.

**Finishing Inside.**—The  $1\frac{1}{8}$ " hole has been drilled with a  $1\frac{1}{16}$ " lathe drill, but as such a tool cannot be relied upon to drill true to center, or size, it is necessary to turn it out with a boring tool. With this tool the hole can be bored true to center and within .01" of the finished size.

The boring bar used in this case is the same as shown in Fig. 80, but the cutter has a rounded point and is similar to the tool used for outside turning except that it is ground with less clearance.

**Setting Boring Bar.**—After clamping boring bar in the tool post, move it through the hole to make sure that it clears. If the bar should touch the hole it will cause the cutter to spring away from the work.

**Why Reamers Are Used.**—To bore a hole straight and true to size requires considerable time and skill, therefore, to conserve time and insure accuracy the hole is finished with a shell or lathe reamer held in the lathe as shown in Fig. 81 or Fig. 82.

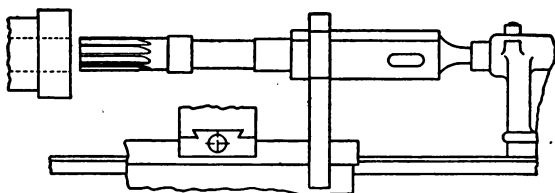


FIG. 81

**Boring and Reaming the Hole.**—Before starting the reamer, the hole should be bored at the end, for a distance of about  $\frac{1}{8}$ ", to the size which will just permit the reamer to enter. This diameter must be calipered very carefully and should be tested with the reamer itself. The rest of the hole is then bored about .01" smaller in diameter to allow enough material for finishing with the reamer. This will require several cuts and the hole should be calipered at both ends. Since

the reamer used in this case cuts on the sides as well as on the end, the hole must be bored true to center in order to be reamed true.

If the reamer has a tapered shank, it is held in the lathe by a square-shank socket and wrench, as shown in Fig. 81, and is fed into the work by turning the hand-crank on the tail-stock.

To place the socket in the lathe it will be necessary to remove the tail-stock center. This is done by turning the hand-crank until the tail-stock spindle is drawn in far enough to force the center out.

If a square-shank socket is not available the reamer may be mounted directly in the spindle; in this case a dog should be used to prevent the reamer from turning. If, for any reason, a dog cannot be used, one thickness of a piece of paper should be wrapped around the taper shank of the reamer; then in case it should turn there would be no danger of scoring the tapered hole in the tail-stock spindle.

In case the reamer has a straight shank, it is held as shown in Fig. 82. Here a dog is fastened to the end of the reamer and prevented from turning by a tool clamped at an angle

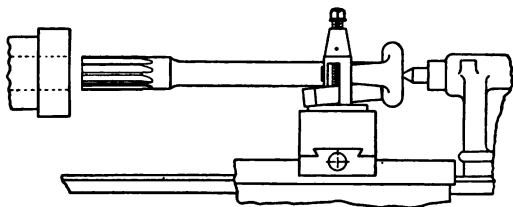


FIG. 82

in the tool-post. The end of the tool presses against the dog near the shank of the reamer so that as the reamer is fed into the work the carriage of the lathe is forced along with it. This causes the tool to hold the end of the reamer against the center of the tail-stock.

When reaming work in a lathe, if the tail-stock is off center the hole will be reamed too large at the front end.

**Accurate Boring With Boring Bar.**—In turning out holes with a boring bar, if all the cuts are started from one end, that end will be bored larger than the other. In case the hole is to be reamed, the reamer will correct this, but if the hole is to be finished with the boring bar it will be necessary to bore the hole from both ends. This is done by reversing the feed of the carriage.

**Speed of Lathe.**—The speed of the lathe for reaming should be slower than when using the boring bar. If the belt is on the second smallest step of the cone with the back gears in, the lathe should have about the right speed for reaming. When using the boring bar, the belt should be on the largest step of the cone without the back gear.

**Inside Threading.**—The inside threads are cut in very much the same manner as the outside ones. The cutting tool is held in the boring bar and, like all boring tools, is ground with less clearance than tools used for outside work.

To regulate the depth of each cut, the screw in the adjustable stop is placed between the stop and the cross-rest. Then by turning the screw in after a cut has been taken the cross-rest can be drawn back to permit a deeper cut with the tool.

**Cause of Threads Breaking.**—When cutting threads in cast iron, they will break if the roughing cuts are too heavy and are liable to if they are cut to a sharp point. Another cause for the breaking of cast iron threads is the use of a dull tool, or one with too little clearance.

**Finishing Threads.**—As a general rule cast iron is machined without using a lubricant, but in finishing threads a little lard oil will aid in producing a smooth finish.

**Finishing Ends.**—The end of the work may be finished by taking a very light cut with the turning tool and then scraping it with a lathe scraper, as shown in Fig. 83. To provide a rest

for the scraper a tool is clamped in the tool-post and as close as possible to the surface being scraped.

A scraper is usually made from an old file ground smooth on the two sides and with a little clearance at the end.

**Finishing Taper.**—To finish the taper, set the compound rest at an angle of  $30^\circ$  with the axis of the lathe. Such a rest is normally at right angles with the lathe axis, so that it must be turned thru  $60^\circ$  to cut  $30^\circ$  angle. A regular turning tool may be used to finish this angle, but it should be set so that the straight side will be nearly parallel with the tapered surface.

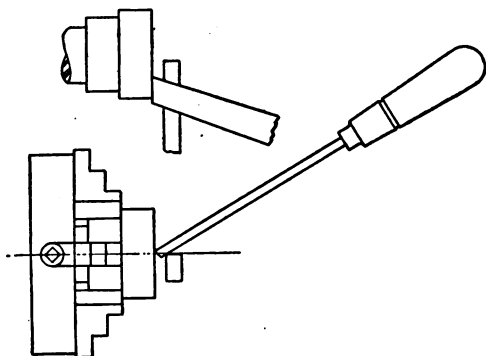


FIG. 83

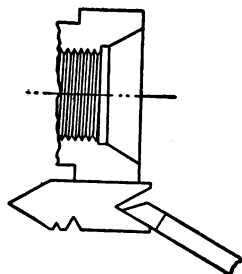


FIG. 84

If the lathe is not provided with a compound rest, the angle may be cut with the side of a tool set at the proper angle. To set this tool, use the thread and center gage, as shown in Fig. 84.

In case the angle is other than  $30^\circ$  or  $60^\circ$ , it is necessary to set the tool with a bevel and bevel protractor.

After the taper has been cut, it may be finished smooth by scraping with a lathe scraper in very much the same manner as shown in Fig. 83. The tool that is used as a rest is set in as close as possible to the taper. If this rest is too far away

from the surface being finished, the scraper will chatter, leaving a rough surface.

**Polishing the Inside.**—Wet the inside with oil and sprinkle it with a little powdered emery or carborundum. Run the lathe at its highest speed and polish by holding the end of a small piece of soft wood on the work.

Piece B.

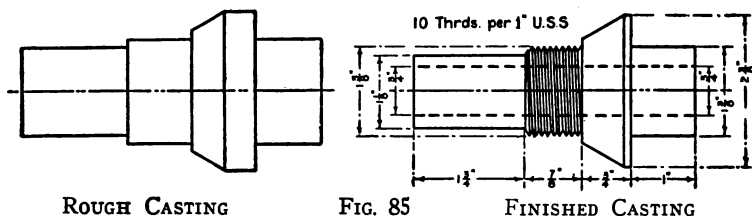


FIG. 85

FINISHED CASTING

**Drilling and Reaming.**—This piece is first placed in the chuck, as shown in Fig. 86, and the end rough-turned to see if it is a good casting. The hole is then drilled with a  $23/32''$

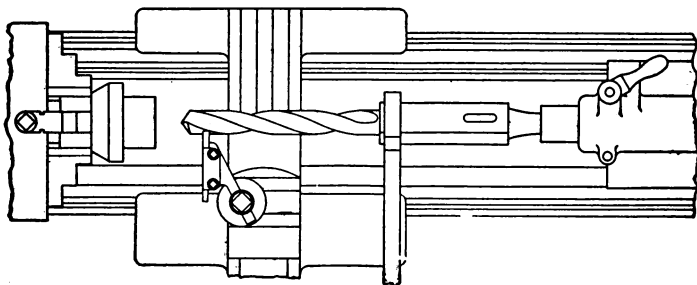


FIG. 86

twist drill and reamed out to size with a  $3/4''$  rose reamer.

**Centering Twist Drill.**—This drill will not bore a hole in the center unless the point is controlled in some way. To do this, a cutting-off tool is clamped in the tool-post with its point well above the center of the lathe and is then moved

close to the point of the drill. As the drill starts to cut, it wobbles a little on account of the point being off-center. The cutting-off tool is then gradually brought against the drill which is at the same time being slowly fed into the work by turning the hand crank on the tail-stock. It is necessary to have the drill centered true before it begins to cut the full diameter.

The drill should be placed in the tail-stock so that the cutting edges are vertical. If they are horizontal, it will be difficult to make the drill center.

If the hole in this piece were larger, it would be cast with a core and then machined in the same manner as the  $1\frac{1}{8}$ " hole in piece A, but since it is cast solid, the hole can be machined more advantageously by using a twist drill and a rose reamer.

**Reaming.**—After the hole has been drilled with the  $\frac{23}{32}$  drill, bore it out with a small boring tool for about  $\frac{1}{8}$ " from the end to the diameter that will just fit over the reamer and insure its starting true. Ream the hole with the reamer held in the same manner as the twist drill in Fig. 86.

**Speed of Lathe.**—The lathe should run slower for reaming than for drilling. The speed will be about right for this size reamer if the belt is on the largest step of the cone without the back gears being used. The speed for the drill may be much faster. With a high-speed steel drill, the belt can be run on the second smallest step of the cone. If the drill is made of carbon steel, a slower speed should be used.

**Advantage of Rose Reamer.**—In drilling long holes like this the drill is very apt to get off center a little as it is fed deeper into the work, even though it may have been started dead true.

The reamer used in this case is called a rose reamer, or rose bit, and cuts on the end only, A, Fig. 87, the rest of the reamer acts as a guide. For this reason, if the hole is approximately true, say within  $\frac{1}{64}$ ", it will ream the hole

straight and true to size if it is once started true. It will cut smoother and closer to size if oil is used.



FIG. 87

The shell reamer shown in Fig. 81 has a cutting edge on the side as well as on the end, for this reason it will ream a hole smooth without the use of oil. If oil is used with this reamer when cutting cast iron it causes the cutting edges to dull quickly, thus reducing the diameter.

Oil is used with all kinds of reamers when cutting steel.

**Finishing Corner.**—After the hole is bored and reamed, the work may be finished at the end by using a tool ground like a threading tool, but having an angle at the point a little less than 90°, as in Fig. 88.

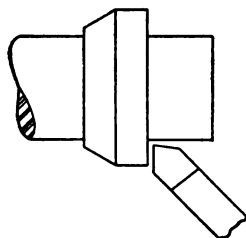


FIG. 88

The boss, or hub, which is 1 3/8" in diameter, is finished with one cutting edge of this tool set nearly parallel to the work, the point being a trifle deeper than the rest. This will insure the full depth of cut for the entire length and also a good sharp corner. The direction of feed for this tool should be from the end and towards the square corner or shoulder. If it is fed in the opposite direction, the tool is apt to chatter.

This tool is also used to finish the end, but it is turned a little in the tool-post so that the other cutting edge is nearly parallel to the surface to be cut. After using this tool, the work may be finished smoother by scraping the ends, as in Fig. 83, and by filing the boss or hub.

**Use of Mandrel, or Arbor.**—Before this piece can be fin-

ished on the outside, it must be forced on a mandrel or arbor, and placed in the lathe, as shown in Fig 89. Most commercial shops are provided with hardened steel mandrels for this purpose, but if one is not available it can be made from soft steel in the following manner:

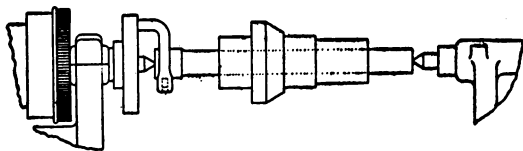


FIG. 89

**Making Mandrel.**—Cut off a piece of steel of suitable length, say 6 inches, and rough turn it to within  $1/32''$  of the diameter of the hole. Then turn it at the end for a distance of about  $1/8''$  to the size that will just fit the hole. The rest of the distance is now turned  $.002''$  or  $.003''$  larger and filed for about  $3''$  until it will just fit the hole. The next  $2''$  are filed with a slight taper so that when the mandrel is pressed into the hole it will fit tight enough to hold the casting while it is being turned. This kind of a fit is called a forced, or driving fit.

When making such a mandrel, it is not necessary to turn that portion to which the dog is fastened.

**Mounting Work on Mandrel.**—Before pressing the mandrel in, it should be oiled to prevent it from being marred or scored. Mandrels are usually forced in with a mandrel press, but if one is not available, they may be driven in with a hammer. When this method is used, a piece of lead, or some other soft material, must be held on the end of the mandrel to keep the hammer from marring the center.

**Finishing Outside of Piece B to Fit A.**—This casting is rough-turned to within  $1/32''$  of the finished size before any part of it is finished. The  $1\ 1/8''$  end is then turned until it fits the corresponding part of the hole in piece A as closely

as possible, and yet not so tight that it cannot be freely rotated. This kind of a fit is called a close running fit.

**Cutting Threads.**—The portion to be threaded should be turned a little smaller than the diameter at the bottom of the threads in piece A. This size is measured by means of the inside spring-thread calipers.

There is no recess, or groove, cut at the end of this thread, so that if the threading tool is allowed to travel farther than the end of the preceding cut, either the point of the tool or the threads may break. To prevent this, the lathe is stopped when the tool is within a half a thread of the end and the cut finished by turning the lathe by hand. In this way the lathe is kept under control and the tool may be drawn back when it reaches the end of the preceding cut. Experienced lathe operators do not, as a rule, turn the lathe by hand, but control the lathe entirely by the shipper.

The tool used for cutting the thread should have the point at one side of the center as shown in Fig. 71, page 58; the reason for this is so that it will cut the thread close to the shoulder.

The speed of the lathe for cutting this thread will be about right for beginners if the belt is on the second smallest step of the cone and the back gears are thrown in.

**Finishing the Angle, or Taper.**—The 30° angle may be cut by setting the compound rest to the correct angle and using a regular turning tool. In case the tool leaves a few tool marks they may be removed by filing.

If the lathe is not provided with a compound rest, this angle may be cut by setting a square-nose tool, as in Fig. 90, with the aid of a thread gauge. Any other angle would have to be set with a bevel and bevel protractor.

This tool is not as wide as the surface to be cut because one that will cut the full width is very liable to chatter. It is therefore better to make several cuts with a narrow tool. The surface can then be finished smooth by filing.

The closeness of the fit of this taper with that in A can be tested by rubbing black paint, which consists of lamp black and oil, on the tapered surface in A. When B is screwed into A, marks will be made on B. If the error is not too great it may be corrected by filing.

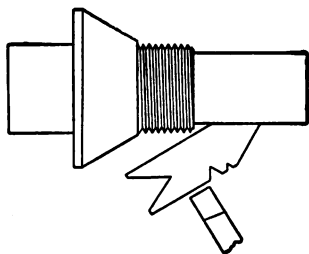


FIG. 90

### Finishing Outside of Piece A.—

Piece A may now be screwed on B and the outside rough-turned to within  $1/32''$  of the finished size.

The ends of the different steps are finished to the proper length with the tool shown in Fig. 88. This same tool can then be used to turn the different diameters to within 0.002" or 0.003" of the required size. These steps are brought to the final size by filing.

**Filing.**—The file for this work should be less than 1" in width. If it is wider than the steps, a beginner will usually file the portion at the end of each step smaller in diameter than that which is close to the square corners.

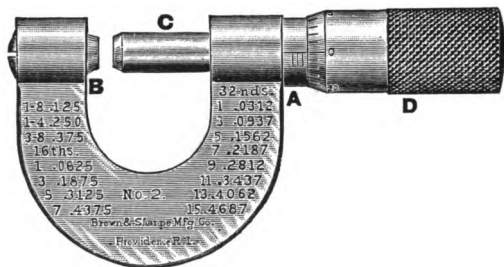


FIG. 91

The different diameters may be measured accurately with the micrometer calipers.

**Micrometer Calipers.**—Micrometer Calipers are used for measuring all sorts of work where great accuracy is required. The different sizes are designated by the largest piece of work

they will measure: i. e., a 1" micrometer has a range from 0 to 1"; a 2" will measure from 1" to 2", and so on up to 12". The 12" size is the largest usually listed by the different manufacturers, altho larger sizes can be obtained.

Fig. 91 shows the 1/2" size.

**How to Read the Micrometer.**—The sectional view in Fig. 92 gives an idea of the inside construction of the head or measuring part of the micrometer.

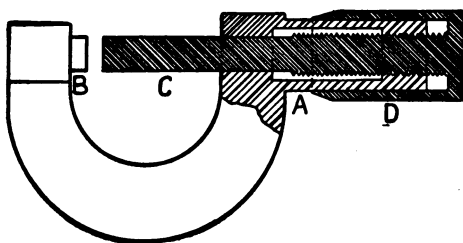


FIG. 92

The spindle C and the thimble D is made in one piece. The threads on the spindle are 40 per inch, so that by rotating the thimble D 40 revolutions the spindle will move longitudinally 1", and by turning it one revolution the spindle will move 1/40" or .025".

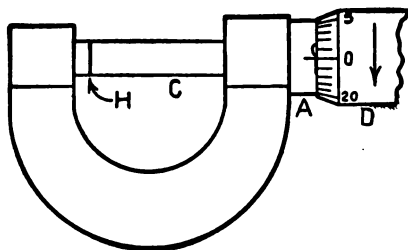


FIG. 93

The thimble D, Fig. 93, has 25 graduations. If it is rotated one graduation in the direction indicated by the arrow,

the caliper will open at H  $1/25''$  of  $1/40''$ , or  $.001''$ ; if it is rotated 6 graduations it will open  $.006''$ .

The graduation on the sleeve A, Fig. 96, are  $.025''$  apart, and every fourth one is numbered. The first numbered graduation represents  $.100''$ , the second  $.200''$ , and so on. Some micrometers also have every fifth graduation numbered; in this case the numbers represent  $1/8''$ ,  $2/8''$ ,  $3/8''$ , etc.

Fig. 93 shows the calipers closed. Now if the thimble is rotated one complete turn it will open  $.025''$ . This brings the end of the thimble to the first graduation on the sleeve A, Fig. 94.

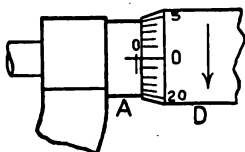


FIG. 94

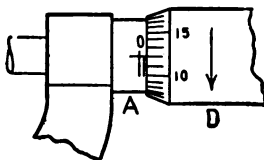


FIG. 95

If it is desired to set the calipers to  $.037''$ , rotate the thimble an additional 12 graduations, as in Fig. 95.

To set the calipers for a common fraction, as  $31/32''$ , first find the decimal equivalent.  $31/32 = .968+$ . Rotate the

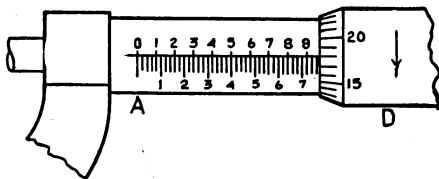


FIG. 96

thimble D to the number 9 graduation on the sleeve A; this is  $.900''$ . Then to the second graduation past the number 9, which is  $.950''$ ; then beginning with zero, rotate the thimble 18 graduations and the caliper is set to  $.968''$ , Fig. 96.

**CAUTION.**—Never use the micrometer caliper on work while it is turning in the lathe.

**Knurling.**—The boss at the end of B is used as a handle so that if it were left smooth it would be hard to turn by hand. The surface is therefore made rough with a knurling tool as shown in Fig. 97. After piece A is finished, it is removed from B and B is reversed in the lathe so that the boss can be knurled.

In case there is enough room between the dog and the work, when held in Fig. 89, there is no need to reverse the work for knurling since it can be done in this position.

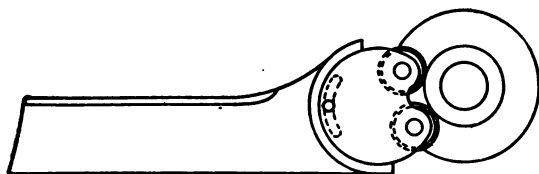


FIG. 97

The speed of the lathe should be about the same for knurling as for thread cutting. If the lathe runs too fast, the knurling tool does not cut satisfactorily.

The tool is set so that the face of the rollers is parallel with the surface to be knurled. When starting the cut, the rollers can be forced into the piece easier if about half of their width extends past the end of the work.

The knurling tool should be pressed into the work fast enough so that about one half the depth of the finished knurl will be cut while the lathe makes three or four revolutions. If the tool is forced in too slowly it will cut a finer knurled surface than the rollers are intended to cut.

The tool is fed along the surface in the same manner as in plain turning. The speed at which the carriage of the lathe moves has no effect upon the pitch of the knurled surface since this is controlled by the pitch of the grooves in the

rollers. If a finer knurled surface is desired, a knurling tool having rollers with finer grooves would have to be used.

**Turning Tool for Brass.**—The tools used for cutting brass are very much the same as for other work, with the exception that the cutting edge should have no rake or lip; that is, the top of the tool should be in a horizontal plane, or nearly so. (A, Fig. 98.) This is very important, for if the tool has any top rake or lip, as is usually the case when turning iron or steel, it is very apt to gouge into the work.

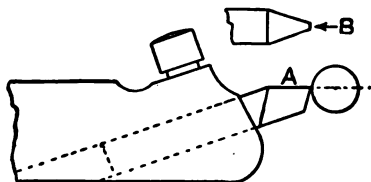


FIG. 98

The point B may be ground with sharp corners as shown, or rounding.

**Drilling Brass.**—Twist drills, as they come from the factory, are ground for cutting iron and steel; in this condition they are not suitable for drilling brass because they have a tendency to gouge into the work. To overcome this, the lip at the cutting edge should be ground straight for about  $1/64$ " and parallel with the axis.

**Cutting Speed.**—When cutting brass the machine is run much faster than for cast iron or steel.


**Problem 8.—Brass Plumb Bob with Steel Point.**

FIG. 99

Piece A.

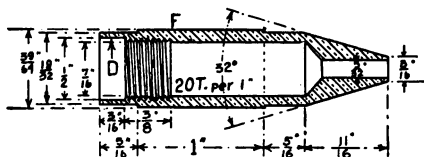


FIG. 100

**Sequence of Operations:**

1. Cut off piece of brass rod  $5/8$ " diameter and  $2\ 3/8$ " long, using power saw or a cutting-off tool in lathe.
2. Place in three-jaw chuck and drill  $7/16$ " hole, and  $5/32$ " hole with straight-shank drills held in drill chuck, as in Fig. 57, page 50.

The drill chuck is prevented from turning by the tight fit of the taper shank. Some mechanics wrap one thickness of a piece of paper around the shank to make it hold better. The paper also protects the hole in the tail-stock spindle from being scored.

3. Finish surface D with boring tool and cut threads with lathe tool, or use tap as in Fig. 46, page 42.

Piece B.




FIG. 101

1. Cut off piece of cold-rolled steel  $1/4$ " diameter,  $13/16$ " long.



is recommended for light work such as this, although the one shown in Fig. 97, page 83, or a hand knurler could be used.

5. Unscrew A from C and drill the  $\frac{3}{8}$ " and the No. 56 hole in piece C. The point of the  $\frac{3}{8}$ " drill should be ground thin; this will cause it to drill a hole with a sharp point at the extreme end. The object of this is to insure the small No. 56 drill starting true.

6. The curved surfaces I. H. are first roughed out with a cutting-off tool, then finished with a forming tool, Fig. 104.

If a forming tool is not at hand the piece may be finished with specially ground bits held in the regular tool holder. It may also be finished with lathe scrapers or hand tools.

If the work is done in the order given one surface will be true with another.

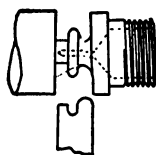


FIG. 104

## CHAPTER VI

### SURVEY OF LATHE AND SHAPER TOOLS

**Shape of Tools.**—Authorities differ as to the proper shaped tools for cutting metal. This is probably due to the varying conditions under which the tools are used. For example, if a certain tool is designed for cutting steel, this tool may give excellent results in a large lathe turning a 6" steel shaft, but for turning a 1" shaft, and in a small lathe, a somewhat different shaped tool might give better results. Again a roughing tool, which will cut off the maximum amount of metal, may be too blunt and clumsy for some jobs.

When a tool is to be used repeatedly on the same kind of work, as is usually the case in a manufacturing shop, it is important to have it as nearly the correct shape as possible. But in an ordinary job shop where the character of work is continually changing the important thing is to get the work done. In this case the desired results may be obtained by using whatever tools are handy, although they may not be exactly suited to the job.

Lathe and shaper tools are divided into two general classes, i. e., forged tools, and tools or bits which are held in a tool holder. Forged tools are more rigid, therefore heavier cuts can be taken and they are less liable to chatter. They can also be used in narrower spaces. Tools held in tool holders being comparatively smaller are cheaper and are more quickly sharpened. Tool holders also have a wide range of application, as any number of different shaped tools or bits can be used in the same tool holder.

The tools described in this book are mostly of the tool-holder type. In case forged tools are to be used the instructions apply equally to them, for there is practically no difference between the two types of tools at the cutting edge.

**Steel for Cutting Tools.**—Cutting tools are usually made from one of two kinds of steel: carbon tool steel, or high-speed steel.

Carbon tool steel has been in use for centuries and is still used for machine shop tools, altho high-speed steel has to a great extent taken its place.

A tool made from carbon steel produces a smoother finish than one made from high-speed steel, because it can be sharpened with a keener edge. In some cases this is important.

Finishing tools used in a tool holder, however, are generally made of high-speed steel, and if properly oil-stoned, will cut smooth enough for most purposes. Finishing tools are also forged from high-speed steel.

Carbon steel is much cheaper and is easier to forge than high-speed steel, which sometimes makes it preferable. This is especially true if the tools made from it are to be used only occasionally.

Carbon steel can be more easily tempered to a certain degree of hardness than high-speed steel. This a desirable feature for such tools as chisels, taps, and dies, etc. If these tools were made as hard as lathe and shaper tools they would not withstand the shock or twisting stresses.

The principal objection to the use of carbon steel is that it will lose its temper, or hardness, when overheated. This occurs when a tool is forced to take too heavy a cut or too fast a cutting speed; in either case the friction causes the cutting edge to heat to such a degree that it becomes blue and it will no longer cut.

High-speed steel will not loose its hardness when so heated, thus giving it a distinct advantage when used for roughing and other tools that are intended for heavy cuts or for high cutting speeds.

High-speed steel is expensive and it is hard to forge. This is the principal reason why it is used so extensively in tool

holders. Also high-speed steel bits for tool holders are hardened ready for use.

**How to Determine the Difference Between High-Speed Steel and Carbon Steel.**—A practical way to determine the difference between high-speed steel and carbon steel is by comparing the color of the sparks when grinding. The sparks from high-speed steel are much darker than those from carbon steel.

**How to Determine the Hardness of Tools.**—The most common method to determine if a tool is hard or soft, is by testing it with a file. If the file cuts without much pressure the tool is soft; if it files with difficulty, it is medium hard; if the file makes no impression upon the steel, it is hard.

**Rate of Feed.**—The rate of feed for small lathe and shaper work ranges from  $1/64''$  to  $1/32''$  for roughing tools and lathe finishing tools. A shaper finishing tool is usually fed faster.

When turning large work, say a 6" shaft, in a heavy lathe, the feed for the roughing cut may be  $1/32''$  to  $1/8''$ , and for the finishing cut  $1/16''$  to  $1/4''$ . The finishing tool has a wide cutting edge. In order to produce a smooth surface the tool must be sharp and a lubricant must be used.

**Depth of Cut.**—The depth of cut for a roughing tool depends largely upon the amount of metal to be removed, the rigidity of the machine and work, and rate of feed. When deep cuts are taken comparatively fine feeds are used, and for shallow cut coarse feeds.

The depth of cut for a finishing tool is usually just deep enough to take out the tool marks left by the roughing tool or to bring the work to size.

### Questions—Chapters IV, V and VI

1. Describe the three different kinds of taps on page 40 and their uses.
2. Will a tap follow a drilled hole true?
3. How are taps used in a lathe?
4. Which is the starting side of a die?
5. What is the difference between a selective-head lathe and a cone pulley lathe?
6. Describe the headstock, tailstock and carriage of a lathe.
7. If the leadscrew of a lathe has 5 threads per inch, what should be the ratio of the gearing to cut a screw with 14 threads per inch?
8. What is the compound rest of a lathe used for?
9. Describe the different kinds of lathe chucks in common use.
10. What is a boring bar used for?
11. Should oil be used when threading cast iron?
12. Why is oil used on a mandrel before it is forced into a hole?
13. Describe how a micrometer caliper will measure to a thousandth of an inch.
14. What is a knurling tool?
15. How are twist drills ground for cutting brass?
16. What is a forming tool?
17. How would you determine the difference between high speed steel and carbon steel?

## CHAPTER VII

### MILLING MACHINE WORK

**Description of Milling Machines.**—There are several different kinds of milling machines, but the ones most commonly used are the plain miller and the universal miller. Both of these machines have horizontal spindles. The difference between them is that the table of the plain miller can be moved only at right angles or parallel to the spindle, while the table of the universal miller may be moved at different angles. The principal advantage of the universal machine occurs in cutting spiral gears, spiral milling cutters, etc. This class of work, however, will not be treated in this book.

As in the case of lathes, there are several makes of millers, all of which, altho varying in efficiency and utility, employ the same fundamental cutting operations. When one has become familiar with the operation of one machine, he should be able to operate other makes of different design with very little difficulty.

Milling machines like many other machine tools have either a cone pulley or a constant-speed drive. The one shown in Fig. 105 has a constant-speed drive.

The driving pulley is at the left of the machine.

The spindle speed changes are obtained by shifting encased gears near the driving pulley. This is done by means of the small pilot wheel and levers on the gear box. The long hand lever at the right of this box operates the clutch for starting and stopping the machine.

The small pilot wheel below, together with the two levers on either side of it, are used for changing the feed. The double-ended V-shaped lever under the table is for starting and stopping the feed. The hand-crank and hand-wheel at

the right are for the hand cross feeds and for raising and lowering the table.

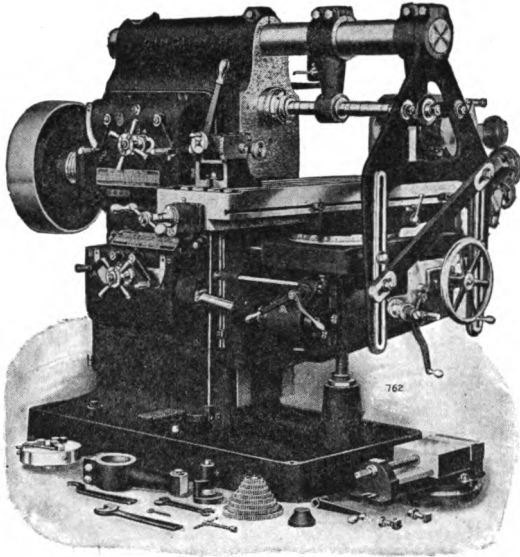


FIG. 105. HIGH-POWER UNIVERSAL MILLER

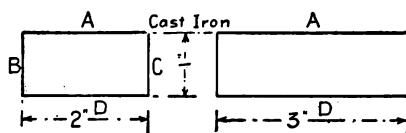
**Problem 9.—Milling a Square Casting.**

FIG. 106

**Sequence of Operations:**

1. Grind off all gates, fins, sand, etc.
2. Clamp in vise and mill side A.
3. Mill sides B and C square with A.
4. Mill side D parallel to A.
5. Mill both ends square with the other sides.

**Object of Grinding Rough Casting.**—The outer surface of cast iron is hard and more or less covered with sand. This would dull milling cutters even more quickly than it would a lathe or planer tool. As milling cutters are expensive and require more time to sharpen, greater care should be taken to protect their cutting edges. It is not necessary, however, to remove all of the scale, but the casting should be thoroughly cleaned.

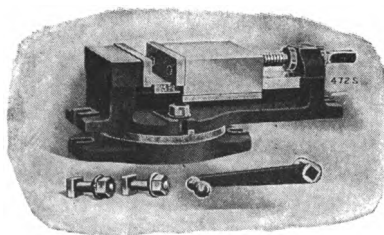


FIG. 107

**Milling-Machine Vise.**—Fig. 107 shows the vise used in the milling machine. It has a graduated swivel base so that it can be turned at different angles.

**Clamping the Work.**—The work is held in the milling machine vise as shown in Fig. 108. It should rest on two parallels that are wide enough to bring the surface to be milled

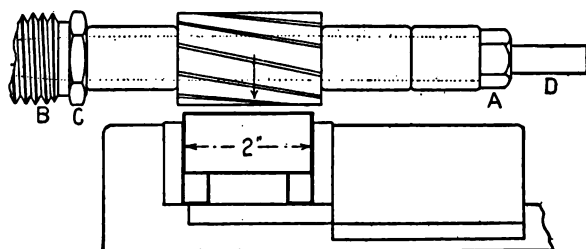


FIG. 108

above the level of the vise. In order to get a tighter grip on it, heavy paper should be placed between it and the jaws of the vise. The paper will also protect the jaws from being marred by the rough sides of the casting.

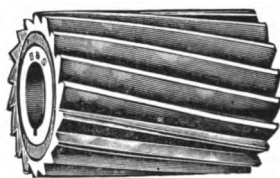


FIG. 109

**The Cutter.**—Work of this sort is milled with a common spiral milling cutter, Fig. 109. As these cutters are made in different lengths, one should be selected that is a little longer than the widest surface to be cut.

**The Arbor.**—All milling-machine arbors are provided with collars, Fig. 108, of different lengths, so that the position of a cutter on them may be varied. These collars slip loosely on over the arbor and, when the nut A is tightened, clamp the cutter in place.

If the cutter is mounted near the main bearing of the milling-machine spindle, it will work better than if located near the outer end.

One end of the arbor is tapered and fits into the spindle B. It may be withdrawn by tightening the nut C. The end D is supported by an out port bearing.

Most arbors are also provided with a keyway, so that when heavy cuts are to be taken or a large cutter used it may be keyed to the arbor.

**CAUTION:**—Beginners are cautioned to be sure that the direction of rotation and speed of the cutter and the direction of the feed are correct before starting a cut.

**Direction of Cutter Rotation.**—Milling cutters are all ground with Clearance A, Fig. 110-a, and if rotated in the wrong direction will not cut. Therefore, before mounting the cutter start the machine and note the direction of rotation of the arbor. If it rotates as indicated by the arrow the cutter should be mounted as shown. If the cutter were mounted as in Fig. 110-b it would not cut.



FIG. 110-a



FIG. 110-b

**Cutter Speed.**—The maximum cutting or surface speed for a milling cutter made of carbon steel is about 50' to 60' per minute when cutting cast iron. Cutting speed is the velocity of a point on the circumference of the cutter. Thus a cutter 2 1/2" in diameter, and turning 90 revolutions per minute, will have a cutting speed of about 60' per minute.

No fixed rule can be given for the proper cutter speed, as too much depends on the character of the work, the hardness of the metal, the size of the machines, etc. Machinists determine the proper speeds by the action of the cutting tool and from previous experiences on work similar in character.

It will be necessary for the instructor to designate the speed of the machine until the student has had sufficient practice to be able to judge fairly well for himself. It is better to run the cutter too slow than too fast, for if it is run too fast it will soon be ruined.

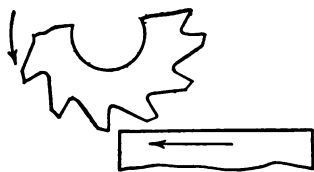


FIG. 111

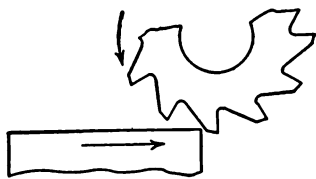


FIG. 112

**Direction of Feed.**—The direction of the feed in relation to the cutter rotation is very important. Fig. 111 shows the correct way. In this case the direction of the feed is opposite to the rotation of the cutter. The wrong way is shown in Fig. 112. If the work were fed in this manner, the cutter would act as a feed roller and draw the work in faster than it would cut. This would break the teeth of the cutter.

**Roughing Cut.**—The roughing cut on cast iron should always be deep enough to get under the scale; in this case about  $3/32''$  or  $1/8''$  deep. Cast iron and brass are milled dry but on steel the cutter works better if lard oil or some other lubricant is used.

**Rate of Feed.**—As in the case of the cutter speed, no fixed rule can be given for the rate of feed. This should be determined by the instructor. It may be stated, however, that  $.018''$  feed per revolution of the cutter should be safe in this case. If a good machine is used and the iron is soft this feed could be increased.

**Finishing Cut.**—The depth of the finishing cut can be anything up to  $1/32''$ . If more than this is taken off, the surface may not be uniform. The same cutter speed as for roughing can be maintained but the feed should be increased. If a

large surface is to be finished and the iron is soft, it will pay, in the amount of time saved, to increase both the speed and the feed.

After side A, Fig. 106, is finished, the sides B and C are milled square with A. D is then milled parallel with A. The method of clamping the work in the vise is practically the same as that used for the shaper work.

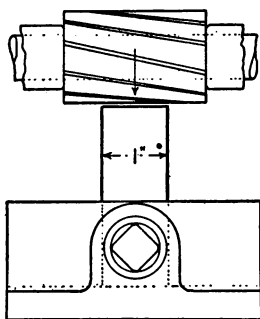


FIG. 113

**Milling the Ends.**—If, in milling the ends, the block extends so far above the jaws of the vise that the action of the cutter has a tendency to tip it, turn the vise through  $90^\circ$  and clamp it edgewise as shown in Fig. 113.

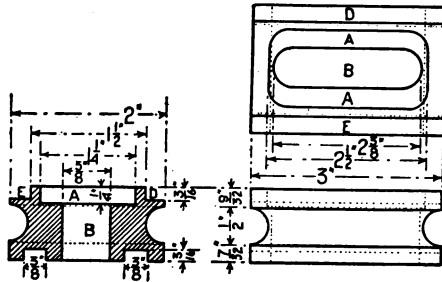
**Problem 10.—Milling a Concave Surface, Recess, etc.**

FIG. 114

**Sequence of Operations :**

1. Mill the recess A and the slot B with a  $\frac{5}{8}$ " end mill.
2. Mill the corners D and E with a side-milling cutter.
3. Mill the grooves in the bottom with a  $\frac{3}{8}$ " milling cutter.
4. Mill the concave sides with a forming cutter.

**Milling the Recess and Slot.**—(Problem 9 is to be used for this problem.) The recess A and the slot B are good examples of the kind of work for which the end mill is particularly adapted. However, this tool is also used for other kinds of work.




FIG. 115

The end mill, Fig. 115, has a taper shank and is mounted in the spindle of the milling machine in the same manner as a drill in a drill press. These shanks have either the Morse taper or the Brown & Sharpe taper. The Morse standard taper is used for drills as well as for end mills. The taper of the Brown & Sharpe standard is less than the Morse

standard. For this reason the shanks of end mills used in milling machines usually have the Brown & Sharpe taper as they will stay in the spindle better.

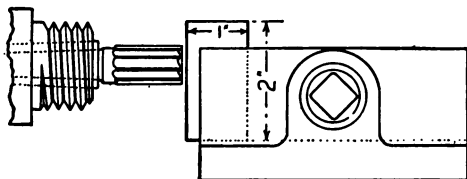


FIG. 116

**Clamping the Work.**—Lay off the outline of the recess on the surface of the block and clamp it square in the vise as in Fig. 116. Adjust the position of the block until the end of the mill is just touching the surface at one corner of the recess. In order to determine when the recess has been cut to the full depth, set the dial on the cross slide to the zero point. This dial is graduated in thousandths of an inch.

**Depth of Cut.**—Force the end of the mill into the surface for about .03" and feed the work by hand so that the mill will cut just inside of the outline marked. Repeat this operation until the cross-feed dial reads .250", the required depth of the recess.

End mills usually work better with shallow cuts and coarse feeds than with deep cuts and fine feeds. Another reason for taking shallow cuts in this case is because there are no teeth at the center of the cutting end A, Fig. 115. This makes it hard to force the tool into the metal.

**Speed of Cutter.**—As this cutter is much smaller in diameter than the spiral mill used in Problem 9 the spindle speed may be increased.

**Milling the Slot.**—The slot is to be milled with the same end mill that was used for cutting the recess. Before starting this cut, remove the work from the vise and drill a 1/2" hole as shown at H, Fig. 117. This hole is necessary on account

of the center of the end mill having no teeth.

After reclamping the work in the vise adjust it so the mill will be at the end of the slot where the hole has been drilled. Feed the cutter thru the block, Fig. 118, as far as the cutting edges will permit. It cuts better in this position than at the outer end.

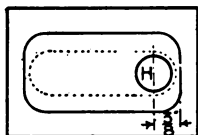


FIG. 117

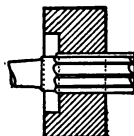


FIG. 118

Now feed the work horizontally until the cutter reaches the other end of the slot.

**Rate of Feed.**—If the automatic feed is used it should be very fine. The safest way for beginners is to feed it by hand. If too coarse a feed is used the cutter will break.

**Direction of Feed.**—When cutting a slot like this, where half of the circumference of the mill is in contact with the metal, and when using the end of the mill as in cutting the recess, the feed may be in either direction.

**Gang Milling.**—When two or more cutters are used on one spindle at the same time it is called gang milling. The cor-



FIG. 119

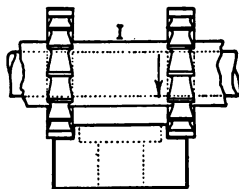


FIG. 120

ners E and D of this problem may be milled by first cutting one and then the other with a side-milling cutter shown in Fig. 119. But if a large number of these pieces were to be

made, two cutters would be used, Fig. 120, with the collar I between them so that they will be the proper distance apart.

A third method is to use a cutter between the side mills instead of a collar. If this method is used the surface should not be milled when squaring the block in Problem 9.

**Depth of Cut.**—When using gang cutters the required depth is usually cut at one time. To set the work for the depth shown in Fig. 114, bring the work up under the revolving cutter until it just touches. Then move the work clear of the cutter and raise it  $3/16''$  or  $.187''$ , using the graduated dial on the elevating shaft.

**Cutting Speed.**—The speed of the machine for gang cutting is determined by the diameter of the largest cutter.

**Groove Cutting.**—The two  $3/8''$  grooves in this problem may be cut with one or two keyway cutters.

The difference between this cutter and the side-milling cutter is that it has no cutting edges on the side. It is used principally for cutting grooves like these and for cutting standard keyways in shafts.



FIG. 121. CONVEX CUTTER

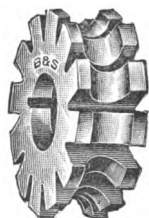


FIG. 122. CONCAVE CUTTER

**Forming Cutters.**—Cutters having curved or irregular cutting edges are usually called formed cutters. The one used for the concave surface in this problem might be classed as such, but is usually called a convex cutter. Fig. 121.

When cutting the concave surface in the end of the block it will be less liable to slip if clamped edgewise in the vise.

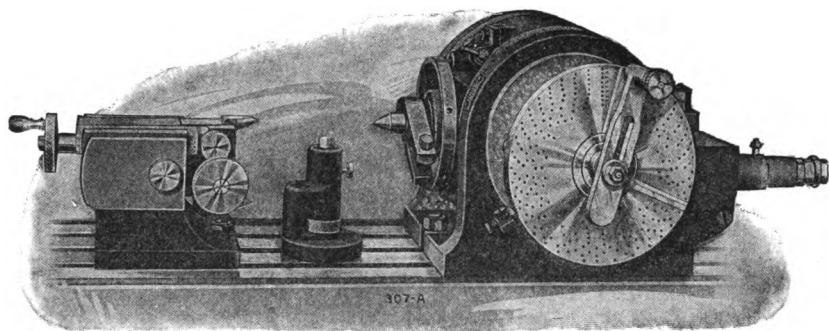
**Dividing Head and Tailstock****FIG. 123**

Fig. 123 shows a dividing head and tailstock. The tailstock is used for holding the ends of shafts, mandrels, etc. The small jack shown is for supporting the middle of long slender work when mounted between the centers.

**The Dividing Head.**—The dividing head is used for accurately spacing or dividing the circumference of a piece of work into any number of parts, as in squaring a shaft, gear cutting, etc.

The center and slotted arm are made in one piece and like a lathe center are held in the spindle of the dividing head by a taper fit. The slot in the arm is to receive the tail of a lathe dog so that work mounted between the centers will rotate with the spindle of the dividing head. The set screw at the end of the slot is to take up the slack or lost motion between the sides of the slot and the tail of the lathe dog.

The spindle of the dividing head is threaded like a lathe spindle so that a chuck may be screwed on it.

**The Index Plate.**—The round plate with a number of circles of holes on the side of the dividing head is called the index plate.

**Index Crank.**—The index crank is in front of the index plate and is provided with a slot so that by loosening the hexagonal nut at the center it may be moved to different positions.

**Index Pin.**—At the end of the index crank is the index pin. One end of this pin is of such size that it just fits into the holes in the index plate. The other end has a knurled knob which is used to withdraw the pin so that the crank may be turned.

**Indexing.**—The shaft on which the index crank is mounted is geared to the spindle of the dividing head at a ratio of 40 to 1. Therefore, 40 turns of the crank will cause the spindle to make one complete revolution.

If it were desired to make 4 divisions, as in squaring a shaft, the number of turns of the crank would be  $40 \div 4$ , or 10 revolutions for each cut. To make 40 divisions, as in a 40-tooth gear wheel, the crank would be turned one revolution for each tooth.

In case 32 divisions are to be made, the turns of the crank per division would be  $40/32$  or  $1 \frac{1}{4}$  revolutions. To turn the crank  $\frac{1}{4}$  of a revolution a circle of holes is selected that is evenly divided by 4, as 24, 36, etc. If the 24-hole circle is used, the crank should be turned 6 holes exclusive of the hole the index pin is in. Therefore to make one of the 32 divisions the index crank is turned 1 revolution plus 6 holes on the 24-hole circle.

**The Sector.**—All dividing heads are provided with a sector which eliminates counting the holes in the index plate each time a division is made.

By loosening the screw A, Fig. 124, the arms D and E may be adjusted to include any desired num-

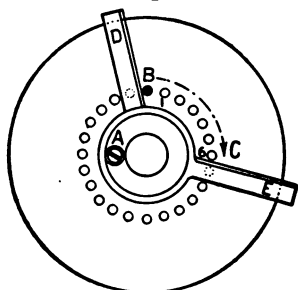


FIG. 124

ber of holes. Thus to turn the index crank  $1/4$  of a revolution on a 24-hole circle the index pin should be rotated from B to C.

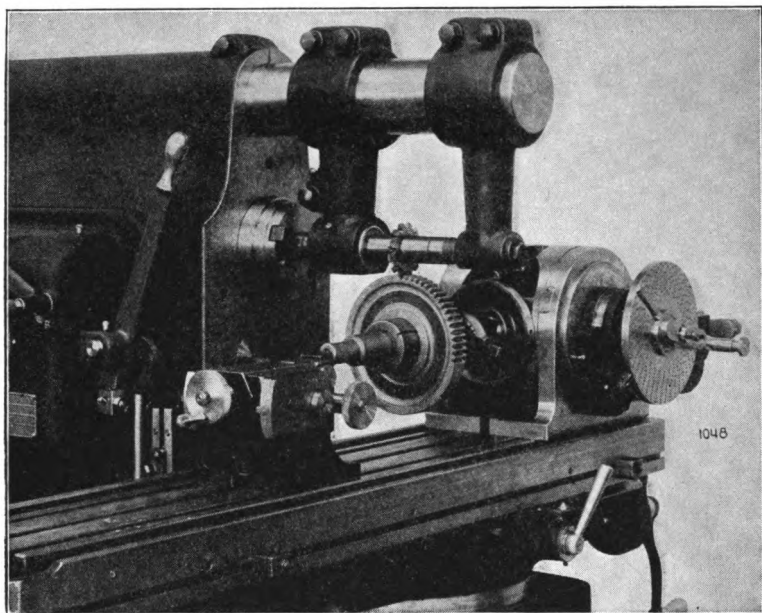


FIG. 125

**Examples of Use for the Dividing Head.**—Fig. 125 shows the method of cutting spur gears. The gear blank is mounted on a special mandrel. The mandrel is supported between the centers of the dividing head. The divisions are made by turning the index crank. The cutter used is a gear-tooth cutter.

An example of accurate indexing is shown in Fig. 126.

Thirty-six  $\frac{1}{4}$ " holes are to be equally spaced on the circumference of a 19" disc. They are first drilled with a short drill a little under size and are then finished to size with a  $\frac{1}{4}$ " end mill.

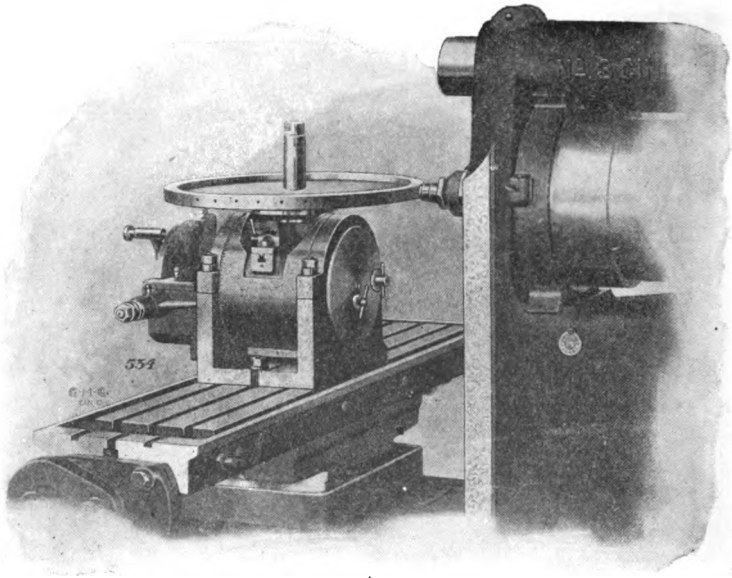


FIG. 126

This figure also shows the method of handling work larger than the dividing head will swing when the spindle is in the horizontal position. In this case the dividing-head spindle has been turned through an angle of  $90^\circ$ .

### Spur Gears and Rack

Gears whose tooth elements are parallel with their axis are known as spur gears. They are also called straight-faced gears.

There are several different systems of gear-teeth outlines, but the one most commonly used is the involute system. This system requires only eight cutters for each pitch and has a wide application.

The operator of a milling machine should become familiar with the following terms: the pitch circle, the pitch diameter, the circular pitch and the diametral pitch.

**Pitch Circle.**—The size of a gear is determined by the pitch circle, C, Fig. 127.

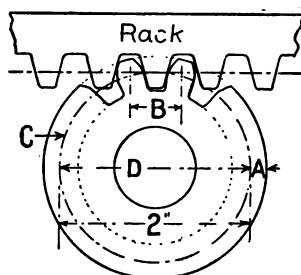


FIG. 127

**Pitch Diameter.**—The pitch diameter is the diameter of the pitch circle, D, Fig. 127.

**Circular Pitch.**—The circular pitch is the distance from the center of one tooth to the center of the adjoining tooth measured on the pitch circle, B., Fig. 127.

**Diametral Pitch.**—The diametral pitch is the number of teeth per inch of pitch diameter. It therefore determines the size of the teeth.

For example, a gear with 12 teeth and a pitch diameter of 2", will have a diametral pitch of 6. One with 16 teeth and the same pitch diameter will have a diametral pitch of 8. Of these two gears the teeth on the 16-tooth gear will necessarily be smaller than those on the 12-tooth gear.

The distance A, Fig. 127, is the reciprocal of the diametral pitch. Thus on an 8 diametral pitch gear, the distance A is  $1/8"$ .

The diametral pitch will hereafter be referred to as the pitch.

**Shape of Tooth.**—The thickness of the tooth on the pitch circle is the same in all sizes of gears having the same pitch. The shape of the tooth, however, varies with the size of the gear; that is, the curve on the side of a tooth on a 12-tooth gear is a little different from that on a gear having 13 teeth. The greatest contrast is noted between a 12-tooth gear and a rack, Fig. 127.

When gear wheels are cut in a milling machine a formed cutter, Fig. 128, having the same profile as the space between the teeth is used. If it were necessary to cut the teeth theoretically correct, a different cutter would be required for each different size gear. In practice, however, for the involute system only 8 cutters are used for each pitch. The following table gives the range of each cutter.



FIG. 128

No. 1 will cut wheels from 135 teeth to a rack.

"	2	"	"	"	"	55	"	134 teeth, inclusive.
"	3	"	"	"	"	35	"	54 " "
"	4	"	"	"	"	26	"	34 " "
"	5	"	"	"	"	21	"	25 " "
"	6	"	"	"	"	17	"	20 " "
"	7	"	"	"	"	14	"	16 " "
"	8	"	"	"	"	12	"	13 " "

For example, if it is desired to cut a 10-pitch gear with 28 teeth, a 10-pitch, No. 4 cutter should be used.

**Rack.**—The teeth of a rack are developed along a straight line and mesh with a gear having the same pitch.

# Rules for Computing Spur Gears

**DIAMETRICAL PITCH** required, circular pitch given. Divide 3.1416 by the circular pitch.

**EXAMPLE.** If the circular pitch is 2 inches, divide 3.1416 by 2 and the quotient, 1.5708, is the diametral pitch.

**DIAMETRICAL PITCH** required, number of teeth and outside diameter given. Add 2 to the number of teeth and divide by the outside diameter.

**EXAMPLE.** If the number of teeth is 40, the diameter of the blank is  $10\frac{1}{2}$ "; add 2 to the number of teeth, making 42, and divide by  $10\frac{1}{2}$ ; the quotient, 4, is the diametral pitch.

**CIRCULAR PITCH** required, diametral pitch given. Divide 3.1416 by the diametral pitch.

**EXAMPLE.** If the diametral pitch is 4, divide 3.1416 by 4 and the quotient, .785", is the circular pitch.

**NUMBER OF TEETH** required, pitch diameter and diametral pitch given. Multiply the pitch diameter by the diametral pitch.

**EXAMPLE.** If the diameter of the pitch circle is 10" and the diametral pitch is 4, multiply 10 by 4 and the product, 40, will be the number of teeth in the gear.

**NUMBER OF TEETH** required, outside diameter and diametral pitch given. Multiply the outside diameter by the diametral pitch and subtract 2.

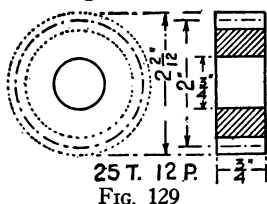
**EXAMPLE.** If the whole diameter is  $10\frac{1}{2}$ " and the diametral pitch is 4, multiply  $10\frac{1}{2}$  by 4 and the product, 42 less 2, or 40, is the number of teeth.

**PITCH DIAMETER** required, number of teeth and diametral pitch given. Divide the number of teeth by the diametral pitch.

**EXAMPLE.** If the number of teeth is 40 and the diametral pitch is 4, divide 40 by 4 and the quotient, 10, is the pitch diameter.

**OUTSIDE DIAMETER** or size of gear blank required, number of teeth and diametral pitch given. Add 2 to the number of teeth and divide by the diametral pitch.

**EXAMPLE.** If the number of teeth is 40 and the diametral pitch is 4, add 2 to the 40, making 42, and divide by 4; the quotient,  $10\frac{1}{2}$ , is the whole diameter of the gear or blank.

**Problem 11.—Gear Cutting.****Sequence of Operations:**

1. Select cutter and mount on milling-machine arbor.
2. Line up center of cutter with center of the dividing head.
3. Place gear blank on mandrel and mount mandrel between centers of the dividing head and the tailstock.
4. Set cutter to proper depth.
5. Set the index crank and sector on dividing head for 25 divisions.

**Selecting Cutter.**—The number of teeth to be cut in this gear is 25. Referring to the table on page 108 it is seen that a number 5 cutter has the proper range.

**Mounting Cutter.**—The cutter is mounted on the milling machine arbor as close to the main bearing of the spindle as possible and yet far enough away to have it line up with the center of the dividing head.

**Centering Cutter.**—In order to cut the teeth radially the center of the cutter must be in line with the center of the dividing head. All gear cutters are marked with a center line so that by moving the dividing head close to the cutter and adjusting the position of the table they may be accurately centered.

**Placing Gear on Mandrel.**—Gear blanks are usually mounted on a gear mandrel, Fig. 130.

This mandrel is not tapered, the clamping being done by means of the nut A. By removing the collars B B several gears can be mounted at one time.

**Mounting the Gear Mandrel.**—A milling-machine dog or a lathe dog is fastened on one end of the mandrel. The latter is then mounted between the dividing-head center and the

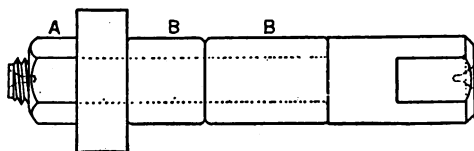


FIG. 130

tailstock center in the manner shown in Fig. 125. Oil should be used on the tail-stock center. The set screw in the slotted arm of the dividing head is screwed against the tail of the dog to prevent any lost motion.

**Depth of Cut.**—When cutting gear teeth of this size all of the stock is removed at one cut. For gears with large teeth, say of 4 or 5 pitch and larger, it may be necessary to take two cuts.

To set the work so that the cutter will cut the proper depth, start the machine and raise the work up under the revolving cutter until it just touches. Move the work clear of the cutter and set the dial on the elevating shaft to zero. Now raise the table .180" as indicated by the graduations on the dial. This is the proper depth for a 12-pitch gear tooth.

All milling machines are provided with a chart that gives the depth to be cut and the range of the cutters for all sizes of gears. The side of each cutter is also marked with this information for its particular pitch and range.

**Setting the Index Crank.**—There is a clamping nut on the side of the dividing head opposite the index plate which should always be loosened before turning the index crank and tightened after indexing. In order to index 25 teeth, the crank must be turned  $1/25$  of 40, or  $1 \frac{3}{5}$  turns per tooth.  $3/5$  of a revolution can be measured on a circle of holes which is a multiple of 5, as 20, 25, 30, 35, etc. Assume the use of the

30-hole circle,  $\frac{3}{5}$  of a revolution will be represented by 18 spaces.

Loosen the nut B, Fig. 131, and adjust the index pin C in one of the holes of the 30-hole circle. Now tighten the nut B just enough to hold the crank in position and pull out the index pin to see if it will drop into the hole without binding. If the index pin is not in line with the hole its position may be changed slightly by rapping the end of the index crank with a piece of wood. If a light rap is not sufficient loosen the nut a little. After the index pin is properly set, tighten the nut B so that it will stay in this position.

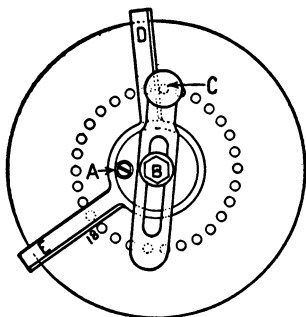


FIG. 131

**Setting the Sector.**—Loosen the clamping screw A on the sector, Fig. 131, and move the arm D so that the beveled edge rests against index pin C. Withdraw the index pin and turn the crank to the right 18 holes, not counting the hole the pin was in. Without changing the position of the arm D move the other arm E until its beveled edge strikes the index pin in its new position at

the 18th hole. Tighten the screw A. The sector is now set to include  $\frac{3}{5}$  of a turn, or 18 spaces.

**Indexing.**—Before taking the first cut, turn the index crank clockwise one complete revolution. This will take out all the slack or lost motion in the dividing head.

To index the gear for the next cut rotate the sector arm D up to the index pin. Withdraw the pin and give the crank one turn to the right or clockwise, plus the fraction of a turn included between the sector arms. This operation is repeated until the gear is finished.

**Cutting a Rack.**—The size of the teeth of a rack, as with spur gears, is designated by the pitch.

To space the teeth it is necessary to know the distance from the center of one tooth to the center of the adjoining one. For a 12-pitch rack this is the same as the circular pitch

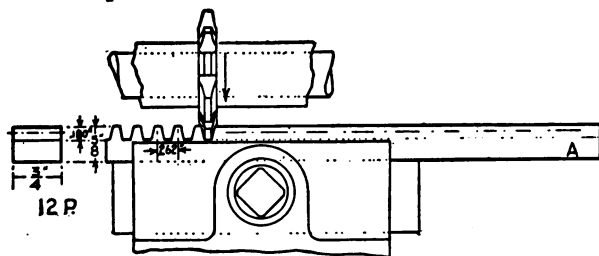


FIG. 132

of 12-pitch spur gears. The circular pitch is obtained by dividing 3.1416 by the diametral pitch. With a diametral pitch of 12 the circular pitch is .262". The following table gives the diametral pitches commonly used and the corresponding circular pitches.

Diametral Pitch	Circular Pitch	Diametral Pitch	Circular Pitch
1¼	2.5133	10	.314
1½	2.0944	11	.286
1¾	1.7952	12	.262
2	1.571	14	.224
2¼	1.396	16	.196
2½	1.257	18	.175
2¾	1.142	20	.157
3	1.047	22	.143
3½	.898	24	.131
4	.785	26	.121
5	.628	28	.112
6	.524	30	.105
7	.449	32	.098
8	.393	36	.087
9	.349	40	.079
		48	.065

Clamp the rack blank in the milling-machine vise on a parallel as shown in Fig. 132. After taking the first cut of the required depth, set the dial on the cross feed to zero. Move the table horizontally .262" as indicated by the dial on the hand crank. Take another cut and continue this operation until the rack is finished. If one end of the rack, as A, extends beyond the vise, it will be necessary to reset the work as the cutter will not cut satisfactorily with such poor support.

## Questions

- (1) If the live lathe center runs out of true what effect does it have on the work?
- (2) If the dead center is out of true what is the effect?
- (3) What kind of a file should be used for lathe work?
- (4) Describe how to center, turn, and thread a bolt in the lathe, as per sketch, Fig. 133. The bolt to be made from a hexagon bar of cold-rolled steel.

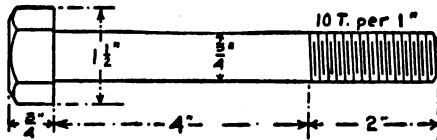


FIG. 133

- (5) What is the difference between a shell reamer and a rose reamer?
- (6) Why is a flat drill used to rough out a core hole instead of a twist drill?
- (7) Should oil ever be used when reaming a hole?
- (8) What is the difference between a tool used for turning brass and one for cast iron?
- (9) When cutting metal with any tool, if the cutting edge breaks down it is usually due to one of the following causes: Machine running too fast, too heavy a cut, the metal being too hard, the cutting tool too soft, or it is improperly set in the tool post. How could it be determined which one of the above caused the trouble?
- (10) How would you machine pulley as per sketch, Fig. 134?

- (11) What kind of steel is used for making chisels, and why?
- (12) What is meant by the cut of a file?

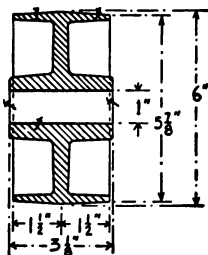


FIG. 134

(13) What is the object of scraping any surface? Give an example other than that given in the book.

(14) Why is the finishing tool, Fig. 18, made wide instead of narrow?

(15) Why are shaper tools ground with less clearance than lathe tools?

(16) Describe how to machine piece of work, as per sketch, Fig. 135, in a shaper.




FIG. 135

(17) How are drills sharpened, and are they made of carbon steel or high-speed steel?

(18) What is the advantage of having drills with taper shanks?

(19) Describe how to drill and tap the journal bearing as per sketch, Fig. 136.

(20) What are the advantages of a milling machine compared with a shaper?

(21) What usually occurs when the work is fed in the same direction that the milling cutter rotates?

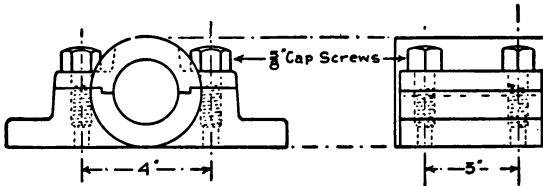


FIG. 136

(22) How would you mill a keyway in a shaft as per sketch, Fig. 137?




FIG. 137

(23) How would you mill 200 pieces as per sketch, Fig. 138?




FIG. 138

(24) Describe how to mill a slot in a piece of work as per sketch, Fig. 139.




FIG. 139

(25) How would you cut a spur gear with 20 teeth 8 pitch?



## INDEX

---

Accurate boring with boring bar	73	Change gears, common	60
Alignment of lathe centers	54	computing for thread cutting	59
Angles of lathe centers	50	patent quick change	46, 49
Angle cutting, in lathe	74, 79	Chattering, cause of, boring tool	69
in shaper	28	shaper finishing tool	22
Arbor or mandrel, gear	110	Chisels, cape, flat	10
lathe	78	round nose or center gouge	39
making of	78	sharpening	10
milling machine	95, 111	use of	10
mounting work on	78	Chipping, cast iron	9
use of	77	Chucks, centering work in	67
Back gears of lathe, use of	68	description of	66
Bolt threading, hand	43	kinds of	66
machine	44	Chucks, drill, use in drill press	36
Boring bar, use of	69	use in lathe	50
Boring hole, with twist drill in lathe	75	Chuck work	66-77
with flat or lathe drill	68	Chucking, advantage of proper	67
Brass turning	84	Compound rest of lathe	47, 62
Calipers, firm joint	57	use of, for thread cutting	64
micrometer	80	angle cutting	68, 79
spring	70	Concave cutter	102
thread, use of	79	Convex cutter	102
Cast iron, turning	66-84	Cutting recess, in steel shaft	57
planing	18-30	with boring bar	70
Center gouge, use of	39	with end mill	99
Center punch, use of	34	Cutters, milling machine	95, 99, 102, 108
Centers of lathe, alignment of	54	Cutting-off tool	57
angle of	50	Cutting off steel	49
Centering flat drill in lathe	67	Cutting threads, brass	85-87
Centering shaft, accurately	50	cast iron	73, 79
combination drill and countersink for	50	steel	58-65
in drill press	50	with die	43
in lathe	50	with tap	41
lathe tool for	50	Die and stock	43
Centering twist drill, in center of circle	39	hand use	43
in lathe	75	use in lathe	44
Centering gear tooth milling cutter	110	Die stock	43
		Dies, threading	42
		Diametral pitch of gear tooth	107
		Direction of rotation of milling cutters	96

- Dividers, use of..... 35
- Dividing head..... 103
- examples of use of..... 105
- illustration of..... 103
- indexing with..... 104, 112
- index crank..... 104
- index plate..... 103
- sector..... 104
- Dog, use of, in lathe..... 51
- Drill bushing or sleeve..... 37
- Drill chuck..... 50
- Drill socket, use of..... 71, 75
- Drill press, description of..... 32
- illustration of..... 33
- sizes of..... 32
- Drill press work..... 32-39
- centering drill..... 39
- holding work in vise..... 35
- holding work with clamps..... 35
- laying off centers for holes..... 34
- starting drills..... 39
- Drilling, brass..... 84
- fixed depth..... 39
- holding work for..... 35
- holes in center of circle..... 39
- in drill press..... 34-38
- in lathe, with twist drill..... 75
- with flat or lathe drill..... 67
- Drills, flat or lathe..... 67
- use of..... 68
- Drills, twist..... 36
- centering in center of circle..... 39
- grinding..... 37
- grinding for brass..... 84
- how held in drill press..... 36
- how held in lathe..... 75
- kinds of..... 36
- sleeve or bushing for..... 37
- socket for holding, in lathe..... 75
- speed of..... 38
- starting..... 39
- Driving fit..... 78
- End mill, illustration of..... 99
- End mill work..... 99-101
- clamping work..... 100
- depth of cut..... 100
- direction of feed..... 101
- milling recess..... 99
- milling slot..... 99
- rate of feed..... 101
- speed of cutter..... 100
- Feeds, rate of, for lathe work.. 90
- for milling cutter..... 97, 101
- shaper work..... 90
- Files, cut of..... 11
- hand..... 11
- lathe..... 11
- size of..... 11
- type or shape..... 11
- Filing, flat surface..... 12
- in lathe..... 55
- Finishing corners, lathe work.. 77
- shaper work..... 29-30
- Finishing end of cast iron, in lathe..... 73
- Finishing, outside of cast iron, lathe work..... 66-74
- Finishing, outside of cast iron, lathe work..... 77-84
- Finishing taper or angle..... 57
- inside with compound rest..... 74
- inside without compound rest..... 74
- outside with compound rest..... 79
- outside without compound rest..... 79
- with lathe scraper..... 74
- Finishing tool, lathe..... 55
- Finishing tool, shaper..... 21
- Flat drills, use of..... 67
- Force fits..... 78
- Forming tool, lathe work..... 87
- Forming cutter, milling machine..... 102
- Gage, drill grinding..... 38
- thread and center..... 58
- U. S. S. thread..... 58
- Gang milling..... 101
- cutting speed..... 102
- depth of cut..... 102
- Gear cutting, see spur gear cutting.
- Gear tooth, shape of..... 108
- terms of..... 107
- Gear tooth cutter..... 108
- Groove cutter..... 102

- Grinding, chisels..... 10  
     scrapers..... 15  
     shaper tools..... 22, 29  
     threading tool..... 59  
     turning tool..... 53  
     twist drill..... 37  
 Hack-saw, use of..... 49  
 Index crank..... 104  
     pin..... 104  
     plate..... 103  
 Indexing, dividing head.... 104, 112  
 Inside threading..... 73  
     cause of threads breaking.. 73  
     finishing threads..... 73  
     tool for..... 73  
     with tap, by hand..... 41  
     with tap, in lathe..... 42  
 Keyway cutter..... 102  
 Knurling tool..... 83, 86  
 Lathe, description of..... 46  
     illustration of..... 47, 60  
 Lathe work, brass..... 84-87  
     cast iron..... 65-83  
     steel..... 46-65  
 Lubricant, use of..... 57  
     for filing..... 13  
     finishing tools, in lathe... 52  
     reaming..... 77  
     tapping..... 41  
     thread cutting in lathe... 57  
     threading with die..... 44  
     threading with tap..... 41  
 Machine, drilling..... 32  
 Mandrel or arbor, gear..... 111  
     making of..... 78  
     milling machine..... 111  
     mounting work on..... 78  
     use of..... 77  
 Micrometer caliper..... 80  
     description of..... 80  
     how to read..... 81  
     use of..... 80  
 Milling, flat surface..... 94-98  
     groove or keyway..... 102  
     irregular surface..... 102  
     rack..... 113  
     recess..... 99  
     slot..... 99  
     spur gear..... 110  
 Milling machine..... 93  
     arbor..... 95  
     clamping work in..... 95  
     cutter..... 95  
     description of..... 92  
     direction of feed..... 97  
     direction of cutter rotation 96  
     finishing cut in..... 97  
     illustration of..... 93  
     object of grinding casting  
         before milling..... 94  
         rate of feed..... 97  
         roughing cut..... 97  
         speed of cutter..... 96  
         vise for..... 94  
 Milling machine cutters.....  
     arbor for..... 95  
     concave..... 102  
     convex..... 102  
     direction of feed for..... 97  
     direction of rotation..... 96  
     end mill..... 99  
     feed for, rate of..... 97, 101  
     forming..... 102  
     for flat surface..... 95  
     gear tooth..... 108  
     grooves or keyway..... 102  
     keyway..... 102  
     rack..... 113  
     recess..... 99  
     side cutting..... 101  
     slots..... 99  
     speed of..... 96, 100  
     spiral mill..... 95  
     spur gear..... 108  
 Parallels, use of..... 26, 35, 95  
 Pitch, diametral..... 107  
     of gear teeth..... 107  
     of screw..... 58  
 Polishing in lathe..... 65, 75  
 Questions..... 31, 91, 115  
 Rack..... 106  
     cutting a..... 112  
     holding the..... 113  
     spacing the teeth..... 113  
     table of pitches for..... 113  
 Reamers, rose, advantage of... 76  
     shell..... 71  
     use of..... 72

Reaming .....	71	testing work for squareness .....	23
speed of lathe for .....	73	to prevent corners from .....	
with rose reamer .....	76	breaking .....	25
with shell reamer .....	71	use of parallels .....	26
Rose reamer, advantage of .....	76	Shell reamer, use of .....	72
use of .....	76	Speed of milling cutters .....	
Roughing inside of cast iron, .....		.....96, 100, 102	
in lathe .....	68	Speed of drills .....	38
advantage of .....	68	Speed of lathe, for brass .....	84
use of boring bar .....	69	cast iron .....	68
use of flat drill .....	68	drilling .....	38
Scraper, brass .....	87	filing .....	55
hand .....	16	knurling .....	83
lathe .....	74	reaming .....	73, 76
Scraping, flat surface .....	13	steel .....	53
in lathe .....	74	thread cutting .....	61, 79
in vise .....	14	Speed of shaper .....	23
Screw cutting, see Thread Cutting.		Spiral milling cutter .....	95
Shaper tools, for cutting angles .....	27, 29	Spur gear .....	106
finishing .....	21	circular pitch .....	107
roughing .....	21	cutter for .....	108
survey of .....	88	diametrical pitch .....	107
Shaper, description of .....	18	pitch circle .....	107
illustration of .....	19	pitch diameter .....	107
size of .....	18	range of cutters .....	108
Shaper work .....		rules for computing .....	109
clamping work in vise .....	26	shape of tooth .....	108
depth of finishing cut .....	23	Spur gear cutting .....	110
depth of roughing cut .....	21	centering of cutter .....	110
direction of feed for finishing tool .....	22	depth of cut .....	111
filing angles .....	30	indexing .....	112
finishing tool .....	21	mounting cutter .....	110
finishing 60° angles .....	29	mounting gear mandrel in .....	
finishing 90° angles .....	29	dividing head .....	111
laying off outline of piece .....		placing gear on mandrel .....	110
of work .....	26	selecting cutter .....	110
planing end of block .....	24	sequence of operations .....	110
rate of feed for finishing tool .....	23	setting the index crank .....	111
rate of feed for roughing tool .....	22	setting the sector .....	112
resetting work .....	23	Spur gear and rack .....	106
roughing out of angles .....	27	Starting drill in work .....	39
roughing tool .....	21	Steel turning .....	49-65
setting finishing tool .....	22	Stock and die .....	43
setting head, clapper box .....		hand use .....	43
and tool for cutting angles .....	28	use in lathe .....	44
		Surface plate, use of .....	14
		Table, drill speeds .....	38
		diametrical and circular .....	
		pitches .....	113
		range of gear tooth cutters .....	108
		Taps, plug, bottoming, taper .....	40
		Taper turning .....	57

- Tapping, brass..... 85  
   cast iron..... 41  
   hand..... 41  
   lathe..... 42  
   lubricant for..... 41  
   square or true..... 41  
 Threads, lead of..... 58  
   pitch of..... 58  
   gage for grinding tool for..... 58  
 Thread cutting, brass..... 85  
   cast iron..... 65-83  
   steel..... 56-65  
   tool for outside..... 59  
   tool for inside..... 73  
   with die by hand..... 43  
   with die in lathe..... 44  
   with tap by hand..... 40  
   with tap in lathe..... 42  
 Thread cutting in lathe..... 56-80  
   boring bar for..... 73  
   chamfering..... 62  
   finishing side of thread.... 63  
   grinding tool for..... 59  
   how to reset tool..... 65  
   setting tool..... 59  
   speed of lathe..... 61  
   to set change gears, for... 61  
   use of adjustable stop.... 62  
   use of die for..... 44  
   use of tap for..... 42  
 Thread gage..... 58  
   tool..... 59  
 Tools, lathe and shaper, survey of..... 88  
 Tools for lathe..... 50-84  
   angle cutting..... 74, 80  
   brass turning..... 84  
   boring bar..... 70  
   centering..... 50  
   corner cutting..... 77  
   cutting-off..... 57  
   end cutting..... 80  
   flat drill..... 68  
   knurling..... 83  
   rose reamer..... 77  
   roughing or turning..... 52  
   scraper..... 74  
   shell reamer..... 71  
   side cutting tool..... 52  
   survey of..... 88  
   threading tool..... 58-59  
   twist drill..... 75  
 Tools for shaper, see Shaper Tools.  
 Tools for vise work, see Vise Work.  
 Turning angles..... 74, 80  
 Turning, brass..... 84  
   cast iron..... 65-84  
   steel shaft..... 49-53  
 Turning taper, by off-setting  
   lathe center..... 57  
   with compound rest.... 74, 79  
 Twist drills, see Drills.  
 Universal chuck, use of..... 66  
 Vise, drill..... 35  
   milling machine..... 94  
   shaper..... 19, 20  
 Vise work..... 9, 41, 43  
   chipping..... 9  
   filing..... 12  
   laying off angles for shaper work..... 26  
   laying off centers for drilling..... 34  
   scraping..... 13  
   thread cutting with die... 43-44  
   thread cutting with tap.. 41, 42













---

To avoid fine, this book should be returned on  
or before the date last stamped below

SOM—9-40

---

--	--	--

Palmateer, T. J. 610030  
Elementary machine shop practice.

[illegible]

DATE	MAY 2 '42
------	-----------

LIBRARY. SCHOOL OF EDUCATION, STANFORD

610030

610030

